

Preservation/Restoration of Moton Field

Phase II

THE
JAEGER
COMPANY



Tuskegee Airmen
National Historic Site
Tuskegee, Alabama

Historic Structure Report
Entrance Gate

Contents

MANAGEMENT SUMMARY

Executive Summary
Administrative Data

PART I: DEVELOPMENTAL HISTORY

Historical Background and Context
Chronology of Development and Use
Physical Description

PART II: TREATMENT AND USE

Ultimate Treatment and Use
Requirements for Treatment
Alternatives for Treatment

APPENDICES

- A. Archival Documents, Photographs, Architectural Drawings
- B. Bibliography
- C. Conditions Assessment/Features Inventory
- D. Materials Analysis
 - Paint Analysis
 - Mortar Analysis

Management Summary

Executive Summary

Administrative Data

Executive Summary

Tuskegee Institute (now Tuskegee University) was the only institution during World War II that provided primary military flight training for African-American pilot cadets in the United States Army Air Corps. Tuskegee Institute constructed Moton Field in Tuskegee, Macon County, Alabama, from 1941 to 1945 and used it as the principal facility of their contract primary flying school. The airfield was named for the second president of Tuskegee Institute, Robert Russa Moton. Most Tuskegee Airmen received their first military flight training at Moton Field.

The Tuskegee Airmen were the first African-American soldiers to complete their pilot training successfully and enter the Army Air Corps. Military leaders were at first hesitant to use the Tuskegee Airmen in combat. Eventually the airmen saw considerable action in Europe and North Africa. Their accomplishments in the air proved conclusively that African Americans could fly and maintain sophisticated combat aircraft and ultimately paved the way for full integration of the United States military.

The Southeast Regional Office of the National Park Service (NPS) prepared the *Moton Field/Tuskegee Airmen Special Resource Study* in October 1998 to evaluate the potential of adding Moton Field to the National Park System and to define the significance of the site with regard, specifically, to its association with the Tuskegee Airmen during World War II and, in general, to its role in the history of military aviation. The airfield complex at Moton Field was designated as the Tuskegee Airmen National Historic Site in November 1998 and was subsequently programmatically listed in the National Register of Historic Places.

MANAGEMENT SUMMARY

This Historic Structure Report (HSR) has been prepared as part of Phase II of the Moton Field Preservation/Restoration project. Phase II includes the production of a Cultural Landscape Report (CLR) and fifteen Historic Structure Reports for nine extant structures and six non-existing structures. The CLR addresses the Moton Field site as a whole and contains the complete historic context for the site; each HSR contains an abbreviated historic context that focuses on building history. Following is a list of the fifteen structures for which HSRs have been prepared.¹

EXTANT STRUCTURES

Hangar Number One
Skyway Club
Control Tower
Bath and Locker House
Warehouse/Vehicle Storage Building
Dope Storage Shed
Oil Storage Shed
Fire Protection Shed
Entrance Gate

NON-EXISTING STRUCTURES

Hangar Number Two
Cadet Class and Waiting Room
Army Supply Building
Physical Plant Warehouse
Vehicle Maintenance Shed
Guard Booth

A *Moton Field Structure Nomenclature* table clarifying the name of each structure for purposes of the CLR and HSRs follows the Executive Summary.

To prepare the Historic Structure Reports and the Cultural Landscape Report, research was done at a number of repositories and on site. Research included on-site field inspections; interviews of persons associated with the site before, during, and after the construction of Moton Field; and review of primary and secondary sources related to the social and physical history of Moton Field, including NPS files compiled during the preparation of the *Special Resource Study* and selected transcripts from the ongoing NPS Tuskegee Airmen Oral History Project. A list of repositories visited and the primary materials that were reviewed at each is located in the bibliography of the Cultural Landscape Report.

Major research findings resulting from the research phase of the project included the location of a number of primary sources yielding information about the construction and operation of Moton Field. This primary information included original architectural drawings and site plans for the airfield and its expansions throughout the war years; historic photographs of the airfield complex and the flight training activities that took place there; written histories chronicling the airfield's construction and day-to-day operations; information on the building contractor and landscape architect involved in the complex's design and construction; and the history of the site before and after its war-era use for primary flight training.

¹ The Phase II scope of work originally included a seventh non-existing structure, the Shed/Pump House, for which an HSR was to be prepared. After the research phase, however, no specific information had been found on the location or design of a shed/pump house on the Moton Field site. Because of this, the building was dropped from the list of non-existing structures.

MANAGEMENT SUMMARY

The period of significance for the interpretation of Moton Field has been established as 1941 to 1945, the period during which Moton Field was constructed and the Tuskegee Airmen were trained by the contract primary flying school. 1945 will be the date of restoration for the field's extant buildings and site features; the date of reconstruction for Hangar Number Two, the only non-existing building at the field that will be re-created; and the date of interpretation for the remaining non-existing buildings and site features. 1945 is the date by which all the buildings and site features at the airfield that were associated with the flying school had been constructed.

Built in 1943, the Entrance Gate is the only structure at Moton Field constructed for a commemorative rather than a functional purpose. The gate marked the main entrance to the airfield. Based on historical research, a thorough investigation of the building and its relationship to the site as a whole, and the building's significance to the site's interpretation, the Ultimate Treatment and Use Recommendation for the Entrance Gate is **Restoration**. System requirements for restoration of the structure will include a new electrical system and replicated lighting fixtures. The Entrance Gate is a significant structure at Moton Field, and its restoration will be an important component in the interpretation of the airfield to the public.

MOTON FIELD STRUCTURE NOMENCLATURE

EXTANT STRUCTURES

***Use Structure Name in Bold Italics*

<u>Original Name¹</u>	<u>Common/Later Name</u>	<u>NPS Name</u>
<i>Hangar Number One</i>		
Civilian Recreation Bldg.	<i>Skyway Club</i>	All Ranks Club
<i>Control Tower</i>		
<i>Bath and Locker House</i> Mechanics' Bath & Locker Bldg.		Administration/Locker Bldg.
Warehouse, Maintenance Bldg., Vehicle Storage		<i>Warehouse/Vehicle Storage Bldg.</i>
Dope Storage		<i>Dope Storage Shed</i>
Oil House		<i>Oil Storage Shed</i>
Fire Protection		<i>Fire Protection Shed</i>
<i>Entrance Gate</i>		Entrance Gate

NON-EXISTING STRUCTURES

<u>Original Name</u>	<u>Common/Later Name</u>	<u>NPS Name</u>
<i>Hangar Number Two</i>		
<i>Cadet Class & Waiting Room</i> (Cadet Waiting House)	Flight Command Office	Flight Command Office
Supply Building	Army Supply Building	<i>Army Supply Building</i>
<i>Physical Plant Warehouse</i>		Physical Plant Storage
Vehicle & Maintenance Shed		<i>Vehicle Maintenance Shed</i>
Guard House		<i>Guard Booth</i>

¹ Based on architectural drawings, written histories, or other original documentation.

Administrative Data

Locational Data

Building Name: Entrance Gate

Building Location: Moton Field, Tuskegee Airmen National Historic Site, Chief Anderson Drive, Tuskegee, Macon County, Alabama.

Real Property Information

Acquisition Date: November 1998

Total Improvement/Modification Costs to Date: \$810,855 (total construction cost to date for stabilization at Moton Field)

Size Information

Total Length: 69 feet (length in elevation)

Total Height: 11 feet (tallest height at corner brick piers)

Building Code Information

Applicable Codes:

Building /Dwelling Code: 1997 Standard Building Code

Structural Code: 1997 Standard Building Code

Plumbing Code: 1997 Standard Plumbing Code

MANAGEMENT SUMMARY

Mechanical Code: 1997 Standard Mechanical Code

Electrical Code: 1996 National Electric Code

Fire/Life Safety: 1994 Standard Fire Protection Code, 1997 NFPA 101

Seismic Hazard Exposure Group 8- No seismic requirements for architectural, mechanical and electrical systems. There are some minor structural requirements.

Proposed Treatment

Proposed Treatment for the Entrance Gate: Restoration

Related Studies

Moton Field/Tuskegee Airmen Special Resource Study, National Park Service, Southeast Regional Office, Atlanta, Georgia, 1998.

Cultural Resource Data

The Entrance Gate is a contributing resource in the Moton Field complex which was programmatically listed in the National Register of Historic Places as a historic site unit of the National Park Service on November 6, 1998 with the approval by President Bill Clinton of Public Law 105-355 which established the Tuskegee Airmen National Historic Site.

The period of significance for Moton Field has been established as 1941 – 1945, the period during which Moton Field was constructed and served as the principal facility of the primary flying school for the training of the Tuskegee Airmen.

Moton Field is nationally significant for its association with the historic contexts of African-American History and Military/ Aviation History. In both African-American and Military/ Aviation history, the airfield complex is significant for its role as the only primary flight training facility for African-American pilot cadets in the Army Air Corps during the World War II era. The accomplishments of the Tuskegee Airmen in military air combat in both European and North African theaters of operation helped pave the way for the full integration of the United States military and future civil rights advancements.

Recommendations for Documentation, Cataloging, and Storage of HSR Materials

A copy of research materials specifically documenting the Entrance Gate is located within the body or in *Appendix A* of this HSR. A copy of research materials documenting Moton Field as a whole may be found with the Cultural Landscape Report. Pre-stabilization photographs and other photographs taken during and after stabilization work of the Moton Field structures and site will remain with the project architectural firm until the completion of final construction drawings and specifications required for the preservation/ restoration work.

Part I – Developmental History

Historical
Background & Context

Chronology of
Development & Use

Physical Description

Historical Background & Context

Formally approved as Tuskegee Airmen National Historic Site on November 6, 1998, Moton Field is of national importance for its association with the training of the Tuskegee Airmen during World War II. Moton Field, constructed between June 1941 and March 1945, was the only primary military flight training facility for African-American pilot candidates in the United States Army Air Corps during the war. The field, named in honor of Robert Russa Moton, the second president of Tuskegee Institute (now known as Tuskegee University), symbolizes the entrance of African-American pilots into the Army Air Corps under a policy of segregation that was mandated by the military and institutionalized in the South. The buildings that remain at Moton Field have changed little over the years and the historic setting of the 1940s is still discernible.

Context

Opportunities for African-American participation in the United States military were always limited and controversial. Quotas, exclusion, and discrimination based on race reinforced the prevailing attitude in both the military and the general public that African Americans did not possess the intelligence or ability to be successful in the military. This perception carried into the 1940s when military officials still believed that African Americans could not become successful pilots in the Army Air Corps. The Air Corps decided to train a small number of African-American pilot candidates under segregated conditions and in January 1941, chose Tuskegee Institute as a civilian contractor to operate a primary flying school at a location in Tuskegee, Alabama, that would become known as Moton Field. This was the only primary military flight training facility for African-American pilot candidates in the U.S. Army Air

PART I – DEVELOPMENTAL HISTORY

Corps during World War II. The facility symbolizes the entrance of African-American pilots into the Air Corps, although on a segregated basis.

War-Era Construction at Moton Field

Building construction at Moton Field can be divided into three major phases of construction. These construction phases are modern descriptive terms and are not historic nomenclature. The justification for the three phases is based on actual dates of construction as well as the source of funding for each. The primary flying field was not officially known as Moton Field until its dedication in April 1943.

Phase One, beginning in June of 1941 and lasting through December of that same year, consisted of the initial establishment of the airfield (grading and clearing) as well as the construction of Hangar Number One and the Fire Protection Shed. Tuskegee Institute contributed \$20,000, but the major funding source was a \$130,000 loan from the Julius Rosenwald Fund.

Phase Two began in the summer of 1942 and lasted almost a year. Tuskegee Institute's Board of Trustees initially authorized \$15,000 for construction of the Cadet Class and Waiting Room and the Army Supply Building.² Hangar Number Two and the Control Tower, the Bath and Locker House, several small sheds for oil and dope storage, and an addition to Hangar Number One were completed with a \$150,000 loan from the institute's general funds.³

Phase Three began in early spring of 1944 and extended through the summer of the following year. It is believed that Tuskegee Institute funded this third phase of construction as well, but documentation has not been located to support or disprove this. During this phase the Vehicle Maintenance Shed and the Physical Plant Warehouse were constructed and the enlargement of the asphalt parking mat and paving of roadways in the building area were completed. The ground was graded south of Hangar Number One for a civilian recreation building, later known as the Skyway Club, that was not started until 1945.

Phase One Construction (June-December 1941)

Following the final contract negotiations with the Julius Rosenwald Fund, the United States Army, and Samuel Mizel (S.M.) Eich, the owner of the farm land on which the primary flying field would be built, construction of the airfield got underway in the early summer of 1941. "The History of the 66th AAF Flying Training Detachment, Moton Field, Tuskegee Institute, Alabama" states that the contract was signed on June 6, 1941 and construction of the airfield started about the same time.⁴ Archie A. Alexander, a prominent African-American contractor from Iowa, was recruited to supervise the initial phase of airfield construction.

² Julius Rosenwald Fund (JRF) Box 359, Folder 5. General Correspondence.

³ JRF Box 359, Folder 5. General Correspondence.

⁴ "The History of the 66th AAF Flying Training Detachment, Moton Field, Tuskegee Institute, Alabama: Section I," p.1.

PART I – DEVELOPMENTAL HISTORY

By the end of 1941 the first phase of construction was complete. Hangar Number One was constructed for \$44,134, which was included in the total cost of \$148,506.98. The final construction costs were as follows:

Payment in full of contract	\$112,900.00
Extra work by contractors	1,389.50
Purchase of land	33,500.00
Cutting trees	500.00
Allowances for crop damages	217.48
	<u>\$148,506.98⁵</u>

Phase Two Construction (June 1942-May 1943)

The Tuskegee training program expanded per orders of the Army, and the facilities originally constructed for a smaller number of cadets soon became inadequate. By the end of May 1942 plans were underway to construct one new supply building and one cadet waiting house. Hangar space formerly used for supply was converted to a link trainer room and empty office space was nonexistent at the field.⁶ The Tuskegee Institute Board of Trustees authorized special expenditures of \$15,000 to finance these improvements, which were completed by late July 1942.

That fall, when it became necessary to expand the facilities at the field again because of another increased quota of students per class, financing once again was an issue. A request to the Julius Rosenwald Fund for an additional loan was rejected. In addition, they offered no leniency for loan repayment should Tuskegee be able to secure a loan from another source. Ultimately, \$150,000 was secured through a loan from the general funds of Tuskegee Institute to complete the second phase of construction.

In addition to the expansion work completed by July 1942, the following construction was completed during Phase Two. Hangar Number Two was built with lean-to space for a Cadet Ready Room, five link trainers, and space for parachute maintenance, issue, storage, and drying. The Control Tower, a pump house containing chlorination units, the Dope Storage Shed, the Oil Storage Shed, and Bath and Locker House were also part of this phase.⁷ Women began to apprentice as mechanics, due to the manpower shortage during the War that necessitated separate facilities for men and women. Although initial construction had failed to anticipate women workers at the primary flying field, toilet and locker facilities were incorporated into the plans of the Bath and Locker House to remedy the need for women's facilities.⁸

A School Facilities and Civilian Personnel Report dated October 27, 1942 details the status of the construction project with Hangar Number Two including the Control Tower at 7%

⁵ JRF Box 359, Folder 5. General Correspondence.

⁶ "The History of the 66th AAF Flying Training Detachment, Moton Field, Tuskegee Institute, Alabama: Section II," p. 4.

⁷ Ibid, p. 5.

⁸ George L. Washington, *The History of Military and Civilian Pilot Training of Negroes at Tuskegee, Alabama, 1939-1945* (Washington, D.C.: George L. Washington, 1972), pp. 306-307; 310-311.

PART I – DEVELOPMENTAL HISTORY

complete; the Bath and Locker House at 25%; and the Oil Storage Shed at 90% complete. Progress to date on the main field was 20% complete.⁹

During construction it became difficult to obtain some building materials due to the shortage caused by the war. Even with a high priority rating obtained from the Air Force, locating materials often lengthened construction time. This was especially true with regard to the 100-foot span trusses and metal truss ties for Hangar Number Two. Ultimately, David A. Williston, the Landscape Architect at Tuskegee Institute who was responsible for the landscape design at the primary flying field, scoured the campus for suitable trees for cutting and milling the trusses. Construction on the hangar came to a virtual stopping point for two months until truss ties could be located.¹⁰

On November 10, 1942, 35% progress was reported on the main field. Construction on the Oil Storage Shed was complete and Hangar Number Two had reached 35% completion while the Bath and Locker House was 60% complete.¹¹ By November 25, the Hangar progressed to 60% completion and the Bath and Locker House to 75% complete.¹²

In December construction began on the Warehouse/Vehicle Storage Building and a Vehicle Maintenance Shed. The shed, which was located at the east extremity of the building complex, housed trucks and ambulances overnight as well as miscellaneous lumber used for maintenance. The warehouse was a concrete block building located east of where the Physical Plant Warehouse was soon completed.¹³ The December 10, 1942 report boosted the Hangar to 70% completion, the Bath and Locker House to 80%, and the Warehouse/Vehicle Storage Building was 20% complete. Although the main field had been in use over a year, it was only 45% completed as of this report.¹⁴

Despite being only 95% complete in March 1943, offices in Hangar Number Two were occupied in order to relieve office congestion in Hangar Number One. May 1943 marked the completion of the second building phase at the airfield. The Bath and Locker House, Warehouse/Vehicle Storage Building, improvements to the landing field and Hangar Number Two were finished. At this time the Intelligence Office was moved from Hangar Number One to Hangar Number Two, which allowed space for the Intelligence Library. As the Cadet Ready Room was also moved to the second hangar, it allowed trainees free access to the reading materials. The Intelligence Office was a military office that provided secure as well as general information about war activities. The office included an Intelligence Library with reading materials such as magazines, newspapers and intelligence summaries, and a War Room with additional reading materials, models of aircraft, ships, and tanks, and maps of various theaters of operations, all of which were kept updated as the war progressed.

⁹ "The History of the 66th AAF Flying Training Detachment, Moton Field, Tuskegee Institute, Alabama: Section II," Appendix III.

¹⁰ Washington, pp. 301-303.

¹¹ "The History of the 66th AAF Flying Training Detachment, Moton Field, Tuskegee Institute, Alabama: Section II," Appendix IV.

¹² Ibid, Appendix V.

¹³ Washington, p. 312.

¹⁴ "The History of the 66th AAF Flying Training Detachment, Moton Field, Tuskegee Institute, Alabama: Section II," Appendix VI.

PART I – DEVELOPMENTAL HISTORY

Aviation cadets were encouraged to spend a few minutes each day in the Library and War Room to keep themselves informed. The Parachute and Link Trainer Departments also moved into larger spaces in Hangar Number Two. This left more space in Hangar Number One for Engineering and Operations.¹⁵

The airfield was named Moton Field in honor of Tuskegee Institute's second president Robert Russa Moton. In preparation for the official dedication ceremony on April 4, 1943, a brick entrance gate was constructed along the main road to the west of the building complex. The south wall contained a niche that featured a bust of Robert Moton.¹⁶

In July of 1943, Tuskegee Institute made its final payment on the loan to the Julius Rosenwald Fund. Tuskegee Institute president Dr. Frederick D. Patterson summed up this special partnership with the following words:

I think it is safe to say that were it not for the wisdom and generosity of the Rosenwald Fund, in its willingness to make an exception to its stated policy, this favorable accomplishment probably would not be a matter of record today. I am sure also that the action of the Rosenwald Fund encouraged our own trustees to take the larger portion of our free funds to make possible the expansion and promotion of this development. We now have a total investment of approximately \$350,000, and aviation has been developed to the point where I am sure it will be a permanent feature of the work of Tuskegee Institute. When we consider the importance of aviation as a vocation today and what it will in all probability mean in the post-war world, we can see that a contribution of lasting importance has been made.¹⁷

Phase Three Construction (Spring 1944-Summer 1945)

During the first half of 1944, Moton Field experienced yet another program expansion. In March a new Physical Plant Warehouse was completed, which provided additional office and storage space used by the primary flying school contractor, Tuskegee Institute, to better oversee activities at the airfield.¹⁸

A year later construction finally got underway on the civilian recreation building, later known as the Skyway Club. This building was to serve as a recreational facility for employees who worked at Moton Field. Built as a cooperative project, Tuskegee Institute supplied the materials while the employees were expected to contribute most of the labor. "Solo," a locally distributed newsletter at Moton Field, suggested that an appropriate motto for the new building project was, "[t]he harder we work, the sooner we get to play."¹⁹

¹⁵ "The History of the 66th AAF Flying Training Detachment, Moton Field, Tuskegee Institute, Alabama: Section III," pp. 1-2; "History of the 2164th AAF Base Unit (CPS.P)(Formerly 66th AAFSTD), Tuskegee Institute, Alabama: Section IV," p. 39; *Sdo*. 10 March 1945, p. 9.

¹⁶ Washington, p. 310.

¹⁷ JRF Box 359, Folder 5. General Correspondence.

¹⁸ "The History of the 66th AAF Flying Training Detachment, Moton Field, Tuskegee Institute, Alabama: Section IV," p. 1.

¹⁹ *Sdo*. 10 March 1945, p. 9.

PART I – DEVELOPMENTAL HISTORY

The final installment of the History of the 2164th AAF Base Unit, Tuskegee Institute, Alabama covered September through November 1945. This period marked the final phase of primary flying training of African-American personnel at Moton Field. By the end of November all trainees had either graduated, been discharged, or transferred to Tuskegee Army Air Field.²⁰

Post War (1946-1998)

The close of the Army Air Corps contract flying school in November 1945 brought a change in the activity at Moton Field. Charles Alfred “Chief” Anderson, who was a flight instructor at the field for the Army Air Corps, continued to offer private flying lessons from Moton Field. Even though primary flight training operations had ceased at the airfield, the Skyway Club continued to operate as a night club open to the general public during this time. According to Bill Childs, who worked as a mechanic at Moton Field, a private business, Tuskegee Aviation Corporation, formed soon after the end of primary flight training. This corporation used the Moton Field facilities to repair and maintain planes and convert military planes for civilian use. In addition, the corporation operated a G. I. flight school through the G. I. College Bill, and Tuskegee Institute offered a degree in Aircraft Mechanics using the corporation and Moton Field for training. The corporation operated for approximately two years after the war ended.²¹ According to Mr. Childs, the City of Tuskegee attempted to levy Tuskegee Aviation Corporation for a total of four million dollars in taxes, the amount for which the Moton Field property was insured. Rather than pay the taxes, the corporation decided to shut down. The government’s first attempt to tax Tuskegee Institute for the property failed because the school was tax exempt and refused to pay the taxes.²²

After the corporation dissolved, Macon County used the hangars for storage of surplus food and as a distribution center for welfare recipients.²³ During this time, several of the support buildings were turned into housing for employees of Tuskegee Institute. The bare minimum was spent on upkeep of these “cottages” as they were known, and residents did general repairs on the buildings themselves. Bill Childs remembers the Skyway Club serving as a dormitory for male students shortly after the war. The G. I. Bill increased student enrollment, and, while campus dorms were being renovated, the Skyway Club’s original open space was subdivided into smaller sleeping quarters. The building may have been in use as a dormitory until the early 1950s.²⁴

All activity, with the exception of housing Tuskegee Institute employees in the cottages, ceased by the mid-1950s, and Tuskegee Institute put little money into the maintenance and upkeep of the buildings and grounds at Moton Field. According to Ed Pryce, landscape architect and superintendent of grounds and maintenance from 1955-1969, the only official

²⁰ “The History of the 66th AAF Flying Training Detachment, Moton Field, Tuskegee Institute, Alabama: Section XII,” p. 2.

²¹ Telephone Interview with Bill Childs by Debbie Curtis Toole, December 2001.

²² Ibid.

²³ Ibid.

²⁴ Ibid.

PART I – DEVELOPMENTAL HISTORY

upkeep at the field was occasional mowing and maintaining the water and sewer lines. No official use was given to the hangars or sheds during this time. With this lack of maintenance, the buildings and landscape deteriorated.

In the 1960s, the Tuskegee Institute School of Veterinary Medicine began to use the airfield for animal research. The area to the east of the field's building complex contained numerous cattle pens. The school renovated Hangar Number Two into a large animal operating and research lab in the early 1970s, which involved subdividing the large hangar space into operating rooms while the original office and classroom areas were converted into laboratories.²⁵ A fire destroyed the hangar in 1989, and the remaining walls were leveled to the ground. Based on a 1964 floor plan of the Skyway Club, this building may also have been used by the Veterinary School. In the mid-1970s, the school renovated the Warehouse/Vehicle Storage Building into a Swine Research Center.

In 1972, a tract consisting of 325 acres of the original Moton Field was deeded to the City of Tuskegee for development of a municipal airport. Bids for the contract were opened in April of 1972, and construction began a year later by the Dubose Construction Corporation in March of 1973. The Municipal Airport was constructed to the north of the building complex. The new paved runways occupy the southern portion of cleared land where the original grass runways were located.

Creation of Tuskegee Airmen National Historic Site

President Bill Clinton approved Public Law 105-355 on November 6, 1998, which established the Tuskegee Airmen National Historic Site at Moton Field in Tuskegee, Alabama. The site was created to commemorate and interpret the heroic actions of the Tuskegee Airmen during World War II and was established as a unit of the National Park System. With this approval, Moton Field was also programmatically listed in the National Register of Historic Places. Establishment of the site included the acquisition by the National Park Service from Tuskegee University of approximately forty-four acres known as Moton Field.²⁶ This forty-four acre tract includes the nine extant historic structures as well as the former sites of the six non-existing structures. In addition, the tract includes an overlook area that might eventually be the site of a proposed interpretative center. NPS land does not include the grass runways, a portion of the historic taxiway, or a portion of the historic tarmac.

Because of its creation as a contract school, Moton Field facilities have not faced the adaptation or conversion typically experienced by other World War II pilot training facilities. Although deterioration has occurred to the historic fabric, the surviving buildings have not undergone significant alterations. When considered in the larger historic setting, the buildings and surviving landscape features express the field's historic function as a flight training facility. Moton Field retains a high level of integrity for interpretation of the training and activities of the Tuskegee Airmen.

²⁵ Interview with Booker Conley by The Jaeger Company, September 26, 2001.

²⁶ Public Law 105-335. 112 Stat. 3254-3258.

PART I – DEVELOPMENTAL HISTORY

For a complete historical overview and developmental history of Moton Field see the Cultural Landscape Report (CLR) for Moton Field, Tuskegee, Alabama.

Chronology of Development & Use

The Entrance Gate was constructed prior to the field's dedication as Moton Field on Founder's Day, April 4, 1943. Booker Conley, former student and physical plant director at Tuskegee Institute, recalls his part in helping to dig the footings for the gate while he was a student at Tuskegee because "the digging was tough."²⁷

An undated war-era architectural drawing of the planned entrance gate attributed to Edward C. Miller, head of Tuskegee Institute's architecture department, shows that the surviving gate was built as drawn with a few minor exceptions. (See *Figure 1*.) The actual iron gates that were proposed were never installed.²⁸ According to Booker Conley, a simple chain was used instead to block vehicular access.²⁹ In addition, the proposed cement sidewalks on the west side of the gate to the niche and through the archway were never installed.

The Entrance Gate served as the main point of entry into Moton Field. By May 1944 a guard booth was located on the west side of the gate on a grassed island in the road to monitor vehicular traffic at the airfield.³⁰ (See *Figure 2*.)

In 1945, a United States Coast and Geodetic Survey Bench Mark was installed on the north side of the archway on the North Wall. (See *Figure 3*.)

²⁷ Interview with Booker Conley, March 14, 2000. NPS.

²⁸ "Proposed Plan and Elevation Entrance Gate for Airfield No. 2." Edward C. Miller, Architect. Drawn by ML. No date.

²⁹ Interview with Booker Conley, March 14, 2000. NPS.

³⁰ Historic Photograph Collection, Howard University. Guard House photo.

PART I – DEVELOPMENTAL HISTORY

Today the Entrance Gate is still used as the point of entry for Moton Field and the Tuskegee Municipal Airport.

Recent stabilization work performed on structures at the airfield did not include the Entrance Gate.

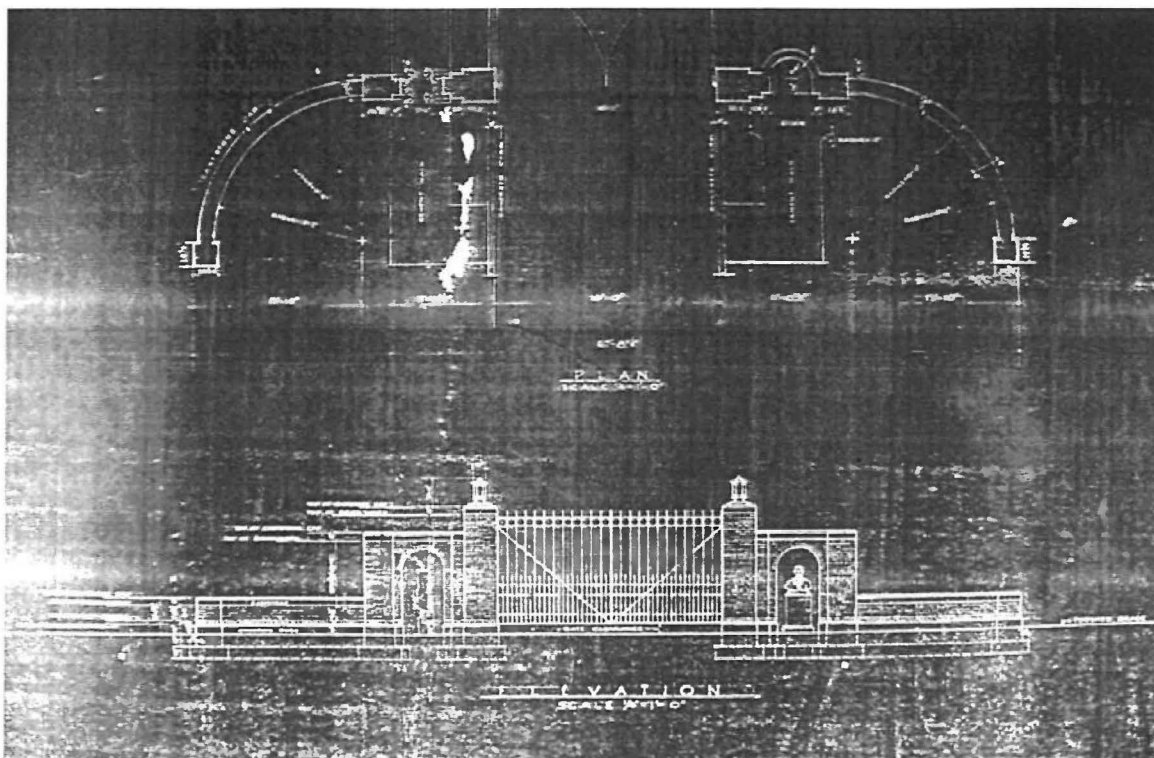


Figure 1: Undated plan and elevation for the Entrance Gate. The iron gates shown were never installed. Physical Plant, Tuskegee University.



Figure 2: 1944 photo of the Guard Booth showing the Entrance Gate in the background complete with lighting fixtures on gate piers and the bust of Robert Moton in the niche. Historic Photograph Collection, Howard University.



Figure 3: United States Coast and Geodetic Survey Bench Mark installed in 1945.



Figure 4: Entrance Gate as viewed from the west.



Figure 5: North Wall of Entrance Gate.

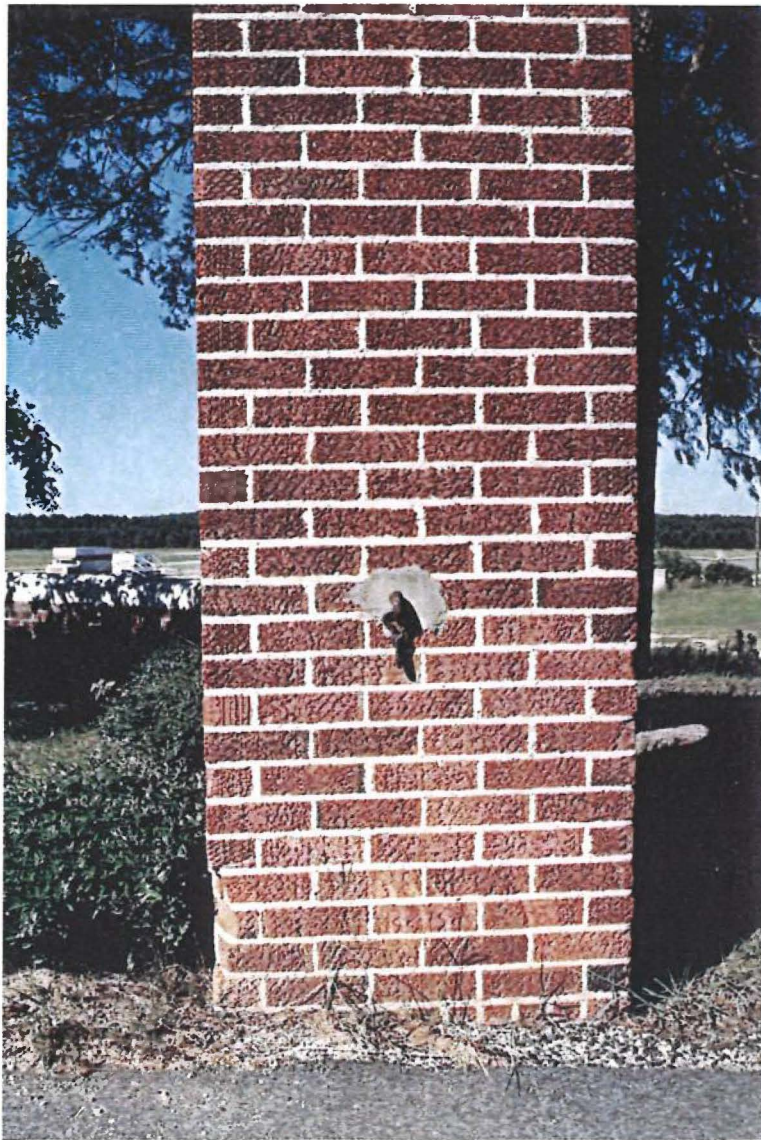


Figure 6: Evidence of the security chain on the south side of the North Wall.



Figure 7: South Wall of Entrance Gate.



Figure 8: Bust of Robert Moton that was formerly located in the niche in the South Wall. AFHRA, Maxwell AFB.

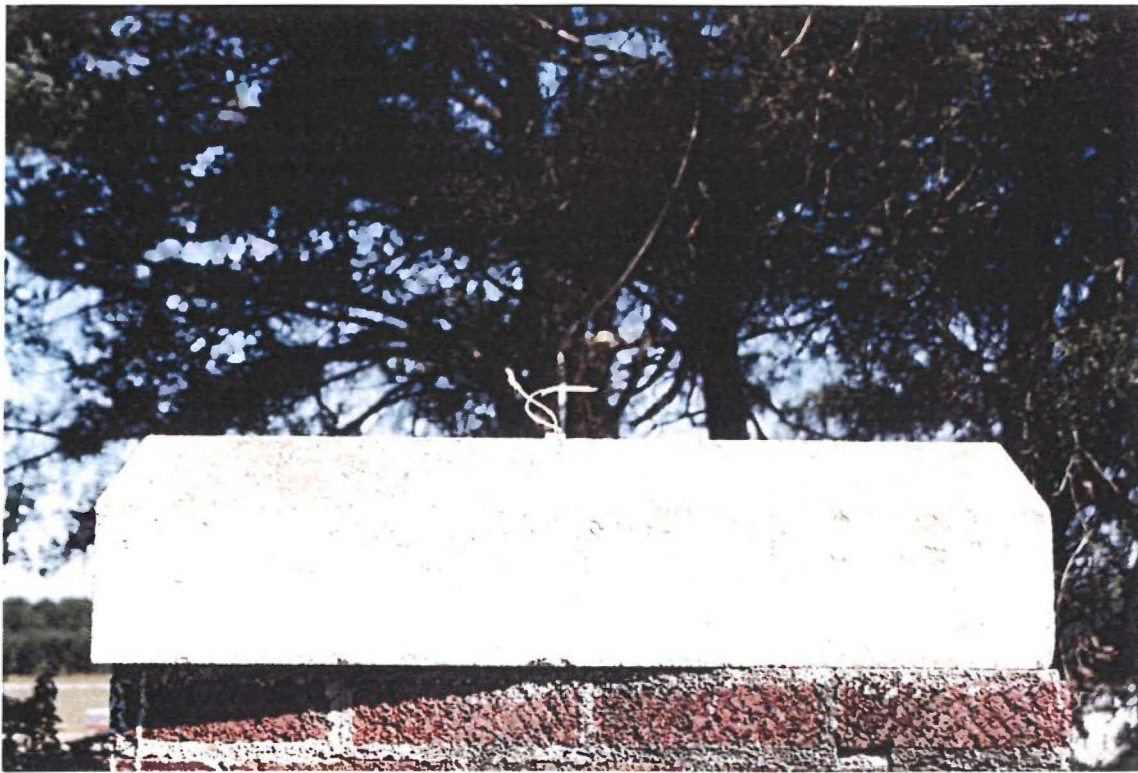


Figure 9: Existing lighting wiring on top of gate pier for lanterns.

Physical Description

The Entrance Gate consists of two sections flanking the entrance road. (See *Figure 4*.) Each section contains a gate pier, a wing wall, and a seat wall. The seat walls extend away from the wing walls in a radial fashion. All portions of the gate are constructed of textured brick veneer laid in a running bond pattern with a soldier ground course. The brick is capped with cast stone sections that have been painted white.

Following is a detailed description of features and materials of the Entrance Gate based on field inspection and supported by a historic architectural drawing and historic photographs. A *Conditions Assessment/Features Inventory* detailing the conditions of each of the following features is located in *Appendix C*. A detailed *Paint Analysis* and *Mortar Analysis* are located in *Appendix D*.

Foundation

The gate is set on a concrete foundation that is below the finished grade.

North Wall (See *Figure 5*.)

The North Wall contains an arched pedestrian entranceway in the wing wall. A United States Coast and Geodetic Survey Bench Mark dated 1945 is located on the north side of the archway. The row of bricks closest to the marker location on this side has been painted white. On the south side of the gate pier an iron ring with one remaining chain link attached has been cemented in the gate twelve courses from the ground. (See *Figure 6*.)

South Wall (See *Figure 7*.)

The south wing wall houses a niche that is of the same proportions as the arched entranceway in the North Wall. This niche contains a marble pedestal with the words *Robert Moton* etched in the front panel. A bust of Robert Moton, second president of Tuskegee Institute for whom the airfield was named, was formerly located on this base. (See *Figure 8*.) The bust has been missing for several years and it is not known whether it was removed for safekeeping or by vandals. The whereabouts of the bust is unknown at this time. During research for this project, inquiries about the bust's possible location were made with those interviewed about Moton Field as well as with Tuskegee University's Physical Plant and Archives. No one was able to provide the bust's current location. It is possible that the bust may be located among the Tuskegee University Archives' collections. The interior rear wall of the niche is finished with a thin layer of cement covered with several layers of paint. On the north side of the gate pier an iron ring with a padlock attached to it has been cemented into the gate twelve courses from the ground.

Lighting/Security

Lighting fixtures, historically located on the tops of the gate piers, were black lanterns with glass globes.³¹ Although the fixtures were installed, it is believed that electricity was never available at the gate.³² Photographic documentation reveals that all light fixtures had been removed prior to 1998. Exposed wiring and ghost outlines of the fixtures on the top of the cast stone are all that remain. (See *Figure 9*.)

The gate remains much as it did sixty years ago. Lichen growth is prevalent on the brick and cast stone, but the gate is structurally sound. The bust of Robert Moton has been removed, and its whereabouts is unknown at this time.³³ There is no longer a way to restrict vehicular access to the airfield at the gate.

³¹ Historic Photograph Collection, Howard University. Guard House photo.

³² Interview with Booker Conley, September 26, 2001. Mr. Conley recalled that wanting electric lighting at the gate was just wishful thinking.

³³ Interview with Booker Conley, September 26, 2001. Mr. Conley stated that the location of the Moton bust is unknown.

Part II - Treatment & Use

Ultimate Treatment & Use
Requirements for Treatment
Alternatives for Treatment

Ultimate Treatment & Use

Two potential treatments based on the standard historic preservation treatments defined in *The Secretary of the Interior's Standards for the Treatment of Historic Properties with Guidelines for Preserving, Rehabilitating, Restoring and Reconstructing Historic Buildings* have been considered for the Entrance Gate. These two treatments are (1) Preservation and (2) Restoration. The Ultimate Treatment and Use Recommendation for the Entrance Gate is **Restoration**. This recommendation is evaluated based on the Criteria for Determining Treatment. The evaluation is followed by a summary of the steps needed to realize the treatment and a summary recommendation based on the practical feasibility of the treatment, the treatment's impact on historic materials, and its effect on the historic character of Moton Field as a whole.

The **Period of Significance** for interpreting the history of Moton Field is 1941-1945, the period during which the buildings and landscape at Moton Field were constructed and the Tuskegee Airmen were being trained in the primary flying school. 1945 is the **Restoration Date** identified for the restoration of extant buildings. 1945 is the date by which the entire complex at Moton Field associated with the training of the Tuskegee Airmen and the operation of the flying school had been constructed.

ULTIMATE TREATMENT AND USE RECOMMENDATION

The Ultimate Treatment and Use Recommendation for the Entrance Gate is **Restoration of the gate based on existing materials and features, historic photographs, and original architectural drawings.**

PART II – TREATMENT & USE

The gate will serve the same function as it did historically— as the formal entranceway to the airfield. However, traffic should be limited to pedestrians; NPS service vehicles and a possible shuttle vehicle operated by NPS should be the only vehicular traffic allowed through the Entrance Gate in an effort to prevent further vehicular damage to the structure and site.

Criteria for Determining Treatment

Following are the criteria that have been used in determining the recommendation for the ultimate treatment of the historic structures at Moton Field. An explanation of how the Entrance Gate meets each criterion for the treatment of restoration is provided.

- **Significance and Value to the Site's Interpretation**

The Entrance Gate is significant and important to the interpretation of Moton Field as the main entry point to the field and as a monument to the man for whom the field was named.

- **Existing Condition and Material Evidence**

The Entrance Gate is in good structural condition. Minor repairs to loose cast stone caps and general maintenance and cleaning will restore the Entrance Gate to its original condition. The major existing condition that will need to be remedied is the missing bust of Robert Moton. Without the original bust of Moton, or a replica, a true restoration is not complete. The nearly unaltered state of the Entrance Gate facilitates a restoration.

- **Archival Documentation**

Historic documentation of the Entrance Gate exists in the form of historic photographs, oral and written histories, and an original architectural drawing. The best historic documentation of the building is provided in the original architectural drawing of the Entrance Gate.

Restoration of the Entrance Gate

Restoration of the Entrance Gate will seek to return the structure to its historic appearance in 1945. This will conserve the structure's existing historic fabric and allow visitors to encounter a similar experience when first entering the field as people who historically entered the field during the time that it served as a primary training facility.

Restoration of the gate will include restoring existing brick and repairing and replacing missing materials. Following are items that should be addressed in the restoration. These items are not in order of importance or how they should be accomplished. A detailed work plan should be devised to establish an appropriate order for accomplishing the restoration work.

PART II – TREATMENT & USE

- Clean masonry with the gentlest method possible to remove dirt, stains, and lichen growth; remove vegetation.
- Replace missing and damaged bricks with masonry units matching existing units in size, color and texture.
- Realign and secure loose capstone.
- Repoint masonry joints as needed using a mortar similar in composition to the existing mortar (see Conclusions in the *Mortar Analysis* in *Appendix D* for recommended compatible mortar); tool to match existing joints.
- If further documentation determines that capstone was historically unpainted, remove current paint in a manner that does not harm the capstone.
- Repair interior of niche.
- Remove paint from original finish of niche if possible, or re-paint based on the Paint Analysis (see Paint Recommendations in the *Paint Analysis* in *Appendix D*).
- Repair structural deficiencies (stress fracture and separation of seat wall from wing wall) in North Wall.
- Clean gate hardware.
- Replicate missing light fixtures on gate piers based on physical evidence and historic photographs.
- Return bust of Robert Moton to its original location or replicate bust if original can not be located.

Additional Documentation Required for Restoration

Following are items that require additional information in order to accomplish a complete and accurate restoration.

- Location of Moton bust
- Original finish of capstone
- Electricity at the gate

Interpretation and Use of the Structure

- The Entrance Gate marks the historic entrance to Moton Field and should continue to function as such.
- Visitors coming into the historic core of the airfield should first pass through the Entrance Gate so that their arrival sequence will be similar to the historic arrival sequence.
- Vehicular access through the Entrance Gate should be restricted to Park Service vehicles and shuttle vehicles only.
- A pedestrian trail should be developed from the parking area/visitor center to allow for visitor safety. Even if the visitor center is located to the southwest of the airfield complex, visitors should be routed through the Entrance Gate to experience the airfield rather than creating a new, nonhistoric access route.

PART II – TREATMENT & USE

Systems Requirements Based on Use

Lighting

- The original fixtures should be replicated to match the fixtures from the historic photos. A new electrical service should be provided for the lights from the new overhead electrical distribution system. Provide power from a pole mounted transformer and provide protective fuses for lights. Route new power underground in PVC conduit to the gate and provide THWN copper conductors.

Summary Recommendation

Because the current condition is so similar to its historic condition, restoration of the Entrance Gate could be accomplished with relative ease. Restoration offers the best opportunity to conserve the structure's remaining historic fabric and fully interpret the role of this structure at Moton Field during the war era. Therefore, restoration is the Recommended Ultimate Treatment.

Requirements for Treatment

Legal mandates and policy directives restrict treatment of the Entrance Gate. The NPS's Cultural Resources Management Guideline (DO-28) requires planning for the protection of cultural resources "whether or not they relate to the specific authorizing legislation or interpretive programs of the parks in which they lie."

Section 106 of the National Historic Preservation Act (NHPA) mandates that federal agencies, including the NPS, take into account the effects of their actions on properties listed or eligible for listing in the National Register and give the Advisory Council on Historic Preservation a reasonable opportunity to comment.

To help guide compliance with the statutes and regulations noted above, the Secretary of the Interior's *Standards for the Treatment of Historic Properties* have been issued along with guidelines for applying those standards.

Issues of human safety are addressed in the Administrative Data and Ultimate Treatment and Use sections. Proper abatement of any hazardous materials will be addressed in the construction phase of the project.

Alternatives for Treatment

One alternative for treatment of the Entrance Gate has been considered and is presented here. It is **Preservation** of the gate in its current condition. This alternative is evaluated based on the Criteria for Determining Treatment. This evaluation is followed by a summary of the steps needed to realize the treatment and a summary recommendation based on the practical feasibility of the alternative, the alternative treatment's impact on historic materials, and its effect on the historic character of Moton Field as a whole.

The **Period of Significance** for interpreting the history of Moton Field is 1941-1945, the period during which the buildings and landscape at Moton Field were constructed and the Tuskegee Airmen were being trained in the primary flying school. 1945 is the date identified during the period of significance by which time the entire complex at Moton Field associated with the training of the Tuskegee Airmen and the operation of the flying school had been constructed.

ALTERNATIVE FOR TREATMENT: PRESERVATION

An alternative for treatment of the Entrance Gate is **Preservation** of the structure as it now exists. Preservation would seek only to repair existing material and maintain the existing character of the gate, making only those repairs necessary to prevent further deterioration to the structure itself and eliminate any threats to life safety. Historic photographs and illustrations would convey the original look of the structure.

Criteria for Determining Treatment

Following are the criteria used in determining the recommendation for the alternatives for treatment of the historic structures at Moton Field. An explanation of how the Entrance Gate meets each criterion for the treatment of preservation is provided.

• Significance and Value to the Site's Interpretation

The Entrance Gate is significant and important to the interpretation of Moton Field as the main entry point to the field and as a monument to the man for whom the field was named. Preservation of the gate in its current condition would protect the structure from further deterioration. Some interpretive value would be lost, however, without the bust of Robert Moton in the niche.

• Existing Condition and Material Evidence

The Entrance Gate is in good structural condition. Additional preservation work would be needed that addresses loose capstone and the separation of the north wing wall from the north seat wall.

• Archival Documentation

Historic documentation through historic photographs and the historic architectural drawing of the gate should be used to determine original features and materials of the gate so that preservation efforts will be as accurate as possible.

Preservation of the Entrance Gate would seek only to repair existing material and maintain the current character of the structure. Repairs would be made to prevent further deterioration of materials and to eliminate possible threats to life safety. Following are items that should be addressed in the preservation and interpretation of the Entrance Gate. Stabilization/preservation work should be clearly differentiated from historic materials. These items are not in order of importance or how they should be accomplished. A detailed work plan should be developed to establish an appropriate order for accomplishing the work.

- Clean masonry with the gentlest method possible to remove dirt, stains, and lichen growth; remove vegetation.
- Repair damaged bricks with masonry units matching existing units in size, color, and texture to prevent further deterioration.
- Realign and secure loose capstone.
- Repoint masonry joints as needed using a mortar similar in composition to the existing mortar (see *Mortar Analysis* in *Appendix D*) in an effort to prevent further mortar deterioration; tool to match existing joints.
- Repair interior of niche.
- Repair structural deficiencies (stress fracture and separation of seat wall from wing wall) in North Wall.

Interpretation and Use Recommendations

- The Entrance Gate marks the historic entrance to Moton Field and should continue to function as such.
- Interpretative display boards that include historic photographs and written text could explain how the gate looked and functioned historically.
- Visitors coming into the historic core of the airfield should first pass through the Entrance Gate so that their arrival sequence will be similar to the historic arrival sequence.
- Vehicular access through the Entrance Gate should be restricted to Park Service vehicles and shuttle vehicles only.
- A pedestrian trail should be developed from the parking area/ visitor center to allow for visitor safety. Even if the visitor center is located to the southwest of the airfield complex, visitors should be routed through the Entrance Gate to experience the airfield rather than creating a new, nonhistoric access route.

Summary Recommendation

The historic fabric of the Entrance Gate has experienced little change over time. Rather than negatively impact the surviving historic material, preservation would seek to protect it. While preservation is a feasible alternative, it does not present as complete a structure as a restoration would. Since restoration could be achieved with minimal effort and cost, preservation is not the Recommended Ultimate Treatment.

Appendices

A p p e n d i x A

**Appendix A is located in a separate notebook that contains the supplemental archival documents, photographs, and architectural drawings for all Historic Structure Reports and the Cultural Landscape Report.

- Archival Documents
- Photographs
- Architectural Drawings

A p p e n d i x B

- Bibliography

Bibliography

Conley, Booker. Interview by Christine Trebellas, 14 March, 2000. Tuskegee Airmen Oral History Project, National Park Service, SERO, Atlanta, Georgia.

Conley, Booker. Interview by Jon Buono, NPS; Anne Wilfer, Debbie Curtis Toole, and Courtney Foley of The Jaeger Company, and Mary Higginbotham, Paint Analysis Consultant, 26 September 2001. Moton Field, Tuskegee, Alabama.

Historic Photograph Collection, Air Force Historical Research Agency, Maxwell Air Force Base, Montgomery, Alabama.

Historic Photograph Collection, Moorland-Spingarn Research Center, Howard University, Washington, D.C.

"Proposed Plan and Elevation, Entrance Gate for Airfield No. 2," Edward C. Miller, Architect, Drawn by M. L. (no date). Tuskegee University Physical Plant, Tuskegee, Alabama.

A p p e n d i x C

- Conditions
Assessment/
Features Inventory

FEATURE INVENTORY: EXTERIOR ENVELOPE**Entrance Gate****Historic Rating Designations**

U - Undetermined (The historic significance of the feature has not been determined)
H - Historic (The feature has historic significance)
T - Treat as Historic (The feature should be treated as if it has historic significance)
N - Not Historic (The feature does not have historic significance)

All Estimable Items

Materials: \$10,086.00 **Labor:** \$5,016.00 **Total =** \$15,102.00

EXTERIOR**4111****Exterior Wall Structure****Masonry**

Feature Description: Brick entrance gate with pre-cast caps.

Feature Notes:

Feature Condition: Fair


Total Inventory: 71 lin.ft.

Historic Rating: H

Priority: Minor

Deficiency: Minor discoloration on bricks
Some deterioration of mortar.

Recommendation: Clean masonry to remove
discoloration without harming existing brickwork.
Repair and repoint mortar as necessary.

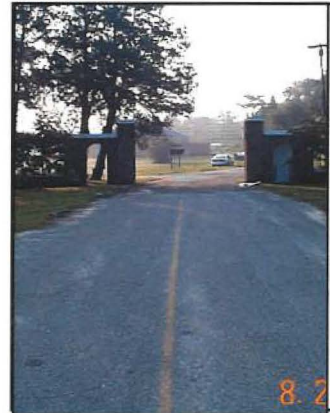

Materials: \$217.00 **Labor:** \$2,846.00 **Quantity:** **Total =** \$3,063.00

EXTERIOR	4111	Exterior Wall Structure	Masonry
-----------------	-------------	--------------------------------	----------------

Feature Description:	Right side of entrance gate
-----------------------------	-----------------------------

Feature Notes:	
-----------------------	--

Feature Condition: Fair

Total Inventory: 1

Historic Rating: H

Priority: Historic

Deficiency:	Missing sculpture for niche.
--------------------	------------------------------

Recommendation:	Repair and re-paint interior of niche. Replicate missing bust and install in niche. The replicated bust is not included in the estimate.
------------------------	--



Materials:	\$5.00	Labor:	\$11.00	Quantity:		Total =	\$16.00
-------------------	--------	---------------	---------	------------------	--	----------------	---------

EXTERIOR	4111	Exterior Wall Structure	Concrete
-----------------	-------------	--------------------------------	-----------------

Feature Description:	Precast coping
-----------------------------	----------------

Feature Notes:	8-1/2" thickness typical. 16-1/2" wide on low wall, 24-1/2"x24-1/2" low wall end caps, 2'-1" x 2'-5" caps at 8 ft height, 2'-9" x 2'-9" cap on columns.
-----------------------	---

Feature Condition: Fair

Total Inventory: 71 lin. Ft.

Historic Rating: H

Priority: Historic

Deficiency:	
--------------------	--

Recommendation:	Clean and re-paint.
------------------------	---------------------



Materials:	\$5.00	Labor:	\$25.00	Quantity:		Total =	\$30.00
-------------------	--------	---------------	---------	------------------	--	----------------	---------

EXTERIOR	4111	Exterior Wall Structure	Concrete
----------	------	-------------------------	----------

Feature Description:

--

Feature Notes: Detail of pre-cast cap on col. At right entry gate

--

Feature Condition: Fair**Total Inventory:** 1**Historic Rating:** H**Priority:** Minor**Deficiency:** Pre-cast cap set askew

--

Recommendation: Re-align and secure as necessary.

--

**Materials:****Labor:** \$100.00**Quantity:****Total =**

\$100.00

EXTERIOR	4111	Exterior Wall Structure	Brick
----------	------	-------------------------	-------

Feature Description: Right entry gate brick column

--

Feature Notes:

--

Feature Condition: Fair**Total Inventory:** 15 brick**Historic Rating:** H**Priority:** Minor**Deficiency:** Deterioration of brick on col.

--

Recommendation: Replace damaged bricks and re-point deteriorated masonry mortar joints as needed.

--

**Materials:**

\$250.00

Labor:

\$327.00

Quantity:**Total =**

\$577.00

EXTERIOR	5833	Exterior Light Fixture	Electrical
-----------------	-------------	-------------------------------	-------------------

Feature Description:	Entrance gate columns
-----------------------------	-----------------------

Feature Notes:	
-----------------------	--

Feature Condition: Fair


Total Inventory: 2

Historic Rating: H

Priority: Historic

Deficiency:	Missing light fixtures
--------------------	------------------------

Recommendation:	Replicate and replace missing light fixtures.
------------------------	---

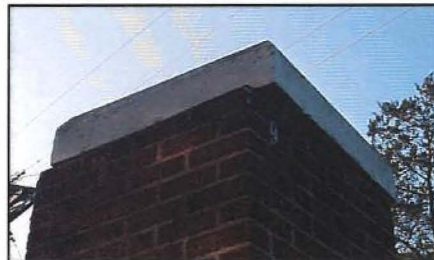

Materials:	\$9,609.00	Labor:	#####	Quantity:	2	Total =	\$11,316.00
-------------------	------------	---------------	-------	------------------	---	----------------	--------------------

Appendix D

- **Materials Analysis**
 - Paint Analysis
 - Mortar Analysis

PAINT ANALYSIS
OF
ENTRANCE GATE
MOTON FIELD
TUSKEGEE, ALABAMA

**PREPARED
FOR
THE JAEGER COMPANY**

**BY
MARYELLEN HIGGINBOTHAM
PRESERVATION/DESIGN CONSULTANT
September 2002**

TABLE OF CONTENTS

INTRODUCTION	Page	1
SCOPE OF WORK	Page	2
GENERAL SUMMARY	Page	3
PAINT ANALYSIS	Page	4
Niche	Page	4
Chromo-chronologies	Page	5
PAINT RECOMMENDATIONS	Page	7
APPENDIX		
List of Figures		
List of Samples		
Frank Welsh Report		

INTRODUCTION

In the summer of 1941, Tuskegee Institute began the development of Moton Field in Tuskegee, Alabama. The extant historic buildings/structures at Moton Field are unique examples of facilities needed for basic flight training during the 1940s. The African-American pilots who trained here made a considerable contribution to the United States flight operations during World War II. After the war, the civilian uses of these buildings/structures included civilian aviation, recreation, and housing in addition to Tuskegee Institute programs. Most of the buildings were vacant and deteriorated by the 1980s.

According to research conducted by the National Park Service and The Jaeger Company, construction of the main buildings/structures at Moton Field began in spring of 1941, with Hangar Number One, and concluded in the summer/fall of 1945, with the Skyway Club. These buildings/structures were constructed in Three Phases and all within five years. The nine extant historic buildings/structures are Hangar Number One, Entrance Gate, Control Tower, Bath and Locker House, Warehouse/Vehicle Storage Building, Dope Storage Shed, Oil Storage Shed, Fire Protection Shed, and Skyway Club.

SCOPE OF WORK

Paint analysis of the paint histories of the nine extant historic buildings/structures at Moton Field has been conducted in two phases. The project began at the request of Amy Kissane, Senior Preservation Planner at The Jaeger Company and is a part of The Jaeger Company's Moton Field Project for the National Park Service. The objective of the first phase of the paint analysis was a survey of the exterior/interior paint history for each of the nine buildings/structures to aid in the development of a restoration and interpretation plan for the site.

Phase One began with a site visit and a review of Moton Field maps, architectural drawings and photographs provided by The Jaeger Company. The site visits were coordinated with Debbie Toole, Architectural Historian for The Jaeger Company. Three days were spent on site at Moton Field. Multiple paint samples were taken from the main architectural elements on the exterior and interior rooms of the buildings or structures. An initial microscopic study of selected paint samples was conducted on site. During the study, more than 200 paint samples were examined under a lighted, 40X stereo microscope. Construction materials and finishes were also considered as tools in understanding the buildings'/structures' paint histories. Pigment analysis and spectrophotometric color matching were not included in this survey.

The objective of Phase Two was to determine, where possible, the paint schemes for the nine extant historic buildings/structures during the designated period of significance "1945". Nineteen paint samples from six buildings/structures were sent to Frank S. Welsh, an Architectural Coating Specialist, for specific color matching to Sherwin Williams Color Swatches. These samples were taken from buildings built just before and during World War II, a period when building materials were expensive and in short supply. Because it was felt that emphasis was on building and not repainting, Mr. Welsh was requested to color match to the original colors on each paint sample. Findings of Mr. Welsh and of the paint survey have been used to recommend, where possible, the color schemes for the nine extant historic buildings/structures at Moton Field.

This written presentation of the paint analysis of the extant buildings/structures at Moton Field includes a brief introduction, scope of work, general summary; paint histories material and color samples; and Mr. Welsh's report. Chromo-chronologies, paint layer sequencing, of each building/structure are presented when possible.

GENERAL SUMMARY

The paint histories of the extant buildings/structures at Moton Field are incomplete puzzles of paint, color, and materials. Time and the elements have not been kind to the original materials remaining in these buildings. In many cases, original materials are missing or so altered as to be unreadable. Paint was often applied thinly and inconsistently within rooms making some paint histories difficult to determine. No paint schedules were located to confirm paint colors. However, colors and paint mediums do provide a general paint history in each building/structure.

Construction materials contributed greatly to the exterior and interior decorative schemes of the buildings/structures. Colors used during the war years reflect the scarcity and cost of paint materials. Although Moton Field was not officially a military facility, the original paint colors found on the site's buildings/structures resemble the gray colors of military facilities of the era. Wooden buildings at Moton Field were painted varying shades of gray with gray to white trim. Building interiors were also painted grays but they became more colorful as the building uses changed over time.

Each building/structure will be discussed chronologically by period of construction and the rooms will be presented according to the POND Architectural Plans. When possible, original paint colors for main architectural elements on buildings and in rooms will be given.

PAINT ANALYSIS

ENTRANCE GATE

The Entrance Gate was completed and dedicated in the Spring of 1943. Again, construction materials determined the decorative finish of the structure---this time brick and concrete.

NICHE

The south wing wall niche in the Entrance Gate is finished with the same rocky finish coat as found on Hangar Number One perimeter walls. Sampling was difficult on the niche's rocky surface. The sample sent to Frank Welsh showed very little substrate and only 2 or 3 new white paint layers. The niche's original finish may have been the white rocky plaster.

CHROMO-CHRONOLOGIES

Chromo-chronologies are presented for those exterior surfaces where there is sufficient substrate and/or paint evidence to determine a paint sequence for that surface.

The original paint layer in the chromo-chronology chart of the Entrance Gate relates to the structure's construction date of 1943.

ENTRANCE GATE

Exterior

Paint Colors	Niche
Original	white concrete
Paint 2	white
Paint 3	white
Paint 4	white

PAINT RECOMMENDATIONS

ENTRANCE GATE

By 1945, the period of significance for Moton Field interpretation, the Entrance Gate would have been approximately two years old. During those two years the mission at Moton Field was building and training: not repainting. Thus, due to the site expansion and the scarcity and cost of paint materials during those two years of WWII it is unlikely that this structure would have been painted more than once.

Given that the Entrance Gate has been painted only 2 or 3 times, the original color might possibly have been the white of the rocky plaster.

Architectural evidence, paint evidence and the above considerations indicate that for the Entrance Gate during the 1945 period of significance, if re-painted, the appropriate color for the niche would be Sherwin Williams white #1004. (See Sample 1) Or, a second option would be paint removal of the existing paint layers down to the original rocky plaster.

The colors would be applied in the following manner:

Exterior

Niche

Sherwin Williams #1004

APPENDIX

LIST OF FIGURES

Figure 1
Entrance Gate

Figure 1
Entrance Gate



LIST OF SAMPLES

Sample 1

Sherwin Williams #1004 color strip

PRELIMINARY LABORATORY DATA

PROJECT	DATE OF ANALYSIS
MOTON FIELD TUSKEGEE, ALABAMA	7/22/02
SPACES	ANALYST
EXTERIORS	Frank S. Welsh
EQUIPMENT	
•Bausch & Lomb stereomicroscope (10 - 105x) •Nikon SKE polarized light microscope •Schott halogen fiber-optic illuminator (3200K)	
DESCRIPTION OF PRESENTATION OF LABORATORY DATA FROM THE ANALYSIS	
■ The following pages contain all of the requisite information found on each sample gathered during the preliminary laboratory analysis of the historically significant coatings. ■ The information on these pages is the data upon which additional research and analyses can be based. ■ Illustrations diagramming the locations from which the samples were taken are included in the Field Note - Sample Location sheets.	
KEY TO THE ABBREVIATIONS USED IN THE LABORATORY DATA SHEETS	
<u>For Layer/Coat:</u> • P = prime or sealer coating • I = intermediate or second prime • Gr = ground or base coating for marbling or graining • F = finish for final coating <u>For Color Name:</u> • W = white • YW = yellowish white • YG = yellowish gray • GY = grayish yellow • MRB = moderate reddish brown • MOY = moderate orange yellow • POY = pale orange yellow • LT = light • MED = medium <u>For Type of coating:</u> • O = oil • D = distemper or calcimine • Wsh = whitewash • Vrn = varnish • Stn = stain • Pb = lead content <u>For Age:</u> • orig = original • er = early • md = middle • lt = late • c = century	

/

Sample Number	Location/Description	Layers and Comments	Sample Number	Location/Description	Layers and Comments
1	Hangar One, Hangar side of metal door into Room 1A.	There is only one layer of old paint on this sample. It is a dark gray, close to Sherwin Williams color # 2117. Above the gray are only 3 layers of new (i.e. mid/late 20th) paints.	4	Hangar One, Paint from South door frame - Room 3 (wood)	The paint evidence is extremely degraded on this sample and almost impossible to evaluate w/ any accuracy. The first finish appears to be white, close to SW color # 1004. The second layer is an aqua color. On another sample in the same envelope there is a second layer that is a Medium Blue-Green.
2	Hangar One, Plaster from interior north wall - Room 1A.	Sample taken at a patch - relatively new.			
3	Hangar One, Plaster from window, north wall, Room 1B.	This plaster is very degraded. It does not appear to be very old. It is grayish white and has only one layer of faded + degraded green oil paint on its surface. The color of the green is close to S.W. Color # 1197	5	Hangar One, Paint from wood door frame - Hangar side into Room 17	The paint evidence on this sample is very degraded. There appears to be two layers of white oil paint - color close to SW # 1004 followed by a Medium Blue Green.

PRELIMINARY LABORATORY DATA SHEETS

Sample Number	Location/Description	Layers and Comments	Sample Number	Location/Description	Layers and Comments
6	Dope Storage Shed. Paint from exterior door & frame	No old paint evidence is on this sample. There are only several layers of newer white paint.	10	Bath & Locker building - exterior trim.	There are 5 layers of paint on this sample. They are: Lt Gray, Dark Gray, Lt Grays & White. The original light gray is the same as on #9. SW Color # 1001.
7	Entrance gate. Concrete from niche	Very little substrate. There are only 2 or 3 layers of new white paint on this sample.	11	Bath & Locker building, plaster north wall Men's Locker Room.	All but one plaster sample in the envelope here is medium gray oil paint as the first finish. It is close to SW color # 2120. One piece of plaster has a lighter gray as the first finish. Its color is close to SW # 2121. Above these first finish coats on all samples are several newer whites & tans.
8	Tower. Concrete interior wall	There are no paints on this sample.	12	Bath & Locker building - window frame - lockers locker room.	There are no old paints on this sample. There are only several new layers of white & tan.
9	Bath & Locker building, paint from exterior siding.	There are approximately 5 finish coats of light gray oil paint on this sample. The first is a lead-based oil paint whose color is very close to S.W. # 1001.			

PRELIMINARY LABORATORY DATA SHEETS

Sample Number	Location/Description	Layers and Comments	Sample Number	Location/Description	Layers and Comments
13.	Skyway club exterior siding.	There are 5-to-6 finish coats of Medium-to-Light Gray oil paint on this sample of siding. The first finish is close to S.W. Color # 1232.	18	Skyway Club. Rm 121 gypsum board on North wall.	There are 4 layers of paint on this sample. The first is buff and close to SW # 1358. The next 3 are light and medium greens.
14	Skyway Club Exterior trim	There are 5-to-6 layers of degraded white paint on this sample. The first finish coat is close to SW Color # 1004.	19.	Skyway Club fiber board north wall - Rm 124	The first finish paint on this sample is a buff, close to SW Color # 1625. There are 4 layers above it. # grayish white, light gray and 2 greens.
15	Skyway Club Room 108 - North wall	- Newer gypsum board			
16	Skyway Club base board Rm 108	No paint is on this tiny sample.			
17	Skyway Club Room 108 - Ceiling	Fiber board. - a grayish white surface with a lot of mica.			



LAW

RESOURCES CREATING SOLUTIONS

March 28, 2002

Ms. Debbie Toole
The Jaeger Company
119 Washington Street
Gainesville, GA 30501

**Subject: Moton Field Mortar Evaluation, Revision
Moton Field Stabilization, Tuskegee Airmen National Historic Site
Tuskegee, Alabama
LAW Project No. 50157-1-4754-01-602**

Dear Ms. Toole:

Law Engineering and Environmental Services, Inc. (LAW) has completed the mortar evaluation as authorized by your company on September 4, 2001. The purpose of this evaluation was to obtain samples of mortar from approximately nine buildings/structures, perform analysis of the mortar to determine its composition and to describe the aggregates. A visual condition survey of the buildings was not a part of the scope of work. This report is a revision of the report submitted on November 1, and the report submitted November 19, 2001. This report has been revised to reflect changes regarding the names of buildings and description of specimens.

Background Information

LAW understands there are a total of nine historical buildings/structures that were built as part of a World War II training facility (1941-1945) and are in the process of being restored. They include Hangar No. 1, Control Tower, Bath and Locker House, Warehouse/Vehicle Storage, Skyway Club, Dope Storage Shed, Oil Storage Shed, Fire Protection Shed and the Entrance Gate. We understand The Jaeger Company is assisting Pond & Company with renovation/restoration design of the facility.

Evaluation Procedures and Results

Site Work

LAW representatives, Mr. Mark Leeman and Ms. Marian Strukel, met with Jaeger Company's Ms. Debbie Toole at the subject site on September 28, 2001. The buildings/structures were observed and samples were taken. Selective sampling of existing masonry mortar and wall plaster materials were taken above-grade and at heights able to be accessed from standing on the ground; no ladders or manlifts were used. Samples were taken from interior and exterior walls. Five buildings/structures were sampled (a total of 10 samples were taken). Two samples of raw sand were taken, one from the road east of the Dope Storage Shed and one from the vicinity of Hangar No. 2. Sand was sampled for comparison purposes. We wanted to compare the sand sampled, both chemically and with respect to gradation, to the sand observed in the mortar.

Mortar samples were not taken from each building at the site. The mortar was observed to be fairly consistent throughout the site. A determination was made in the field that if the mortar was hard and competent then a sample may not have been taken for a particular building if the mortar was consistent with other buildings at the site. This was the case for the mortar at the Entrance Gate, the Skyway Club and the Warehouse/Vehicle Storage buildings. The mortar was judged to be hard and competent; therefore was not sampled for proportions.

Samples were taken at the following locations:

Sample	Construction	Location
1	Brick Mortar	Control Tower - exterior
2	Block Mortar	Control Tower - exterior
3	Brick Mortar	Dope Storage Shed - interior
4	Parge Coat	Hangar No.1 - interior
5	Brick Mortar	Hangar No. 1 - interior
6	Brick Mortar	Hangar No. 1 - exterior
7	Brick Mortar	Fire Protection Shed - interior
8	Brick Mortar	Fire Protection Shed - exterior
9	Plaster	Bath and Locker - interior
10	Gypsum Board and Paper	Bath and Locker - interior

Photographs of the buildings/structures and the samples taken at each location can be found attached to this report.

The masonry units of the structures observed were similar in appearance and were in satisfactory condition. We observed both clay brick masonry and concrete masonry. Deterioration in the form of cracks was not observed. Significant efflorescence staining was not observed on the masonry units. Areas of re-pointing were observed on the Control Tower. We understand this was a part of recent stabilization work.

The mortar observed was intact, competent and not easily scratched with a metal chisel. The mortar joints were well tooled and concave in shape. Several mortar joint surfaces had undergone weathering which resulted in sand particles being exposed on the surface. The mortar was well bonded to the masonry units. The mortar was strong and required significant effort to break out samples from the constructed masonry. In general, our selective sampling indicated the mortar was strong, but occasionally areas of softer mortar were observed. Since softer mortar was encountered infrequently, we did not consider it a representative condition and did not intentionally sample it.

A visual survey of the Skyway Club was performed, but samples were not taken. The mortar observed at this structure was similar to the others and competent. Ms. Toole informed LAW that the block used for the Skyway Club was made with local materials and called "Tuskegee Block". The parge coat mortar taken from Hangar No. 1 was intact, but could be broken easily. The sand particles on the surface of the parge coat were exposed and poorly bonded (Photo 11).

Softer mortar was observed in isolated areas of Hangar No. 1. The mortar appeared to have a higher lime content at some places than the other mortars observed. This determination was made by observation of the mortar color and the hardness of the mortar. The mortar inside Hangar No. 1 ranged from soft (easily scratched with a metal chisel) around the structural clay tile to medium hard around the brick. A section of the exterior south face of this building was re-constructed the summer of 2001. The white colored mortar with a brown surface smear coat was observed (Photo 12). The brown smear coat was applied for aesthetic reasons to match the new mortar to the existing one.

Laboratory Evaluation

Evaluation of the mortars was conducted in accordance with ASTM C1324 "Standard Test Method for Examination and Analysis of Hardened Masonry Mortar". Chemical evaluations and petrographic examinations were made of the mortars. No thermal analysis or x-ray diffraction was performed on the mortars.

Chemical evaluation results can be found in Table 1. The chemical results and petrographic evaluations indicated the mortars were similar in composition. The percentage of insoluble residue, soluble calcium oxide and soluble silica contents were similar in the samples analyzed.

Determination of the mortar composition was performed in accordance with the calculations of ASTM C1324, assuming a portland cement, lime, siliceous sand mixture. Chunks of lime were observed in several samples of the existing mortar, indicating this assumption is reasonable. However, if information becomes available to indicate the mortar was made using masonry cement, the proportion calculations can be adjusted. A package of masonry cement was observed at the project near the new brick construction. This indicates this mortar was made with masonry cement.

This is supported by the chemical evaluations; the proportions calculated are presented in Table 2. The use of non-masonry cement versus masonry cement are two means of achieving the same mortar after construction. The primary difference occurs with material selection and the amount of work performed by the on-site masons during construction. Chemical analysis indicated the mortars ranged from Type M to Type O using ASTM C270 Proportion Specifications. The mortars were generally Types S and N, but an occasional Type M and O were observed. In general, the mortars were hard and the classifications based on the chemical evaluations were in general agreement with our field observations.

The petrographic evaluations indicated the mortars were made with a natural sand. The sand particles were mostly quartz and other hard siliceous minerals. The particles ranged in size from ½ to 1½ millimeters (mm) and were subangular in shape. The sand particles were mostly clear to opaque, tan to smokey gray in color with less than approximately 10 percent of the particles dark in color. No significant component of calcareous aggregate was observed in the sand. The mineralogy of the sand indicated it was a local material. The mortars had an estimated air content of 10 to 20 percent. A lower air content of 5 to 10 percent was observed in the newer mortar located on the exterior wall of Hangar No. 1. The air voids observed in the samples were spherical in shape and evenly distributed in the mortar. The mortar color ranged from light gray to medium gray, except for the new mortar observed outside Hangar No. 1 which was white. This mortar was made with white portland cement. The mortars were hard to medium hard when scratched with a sharp metal instrument. Isolated particles of unhydrated lime were observed in the sample taken from the Fire Protection Shed (exterior, south face).

Freeze-thaw damage was not observed in the samples. Carbonation was observed in the samples taken from the Tower Building (mortar from block), Dope Storage Shed (interior), Hangar 1 (parge coat and interior) and the Fire Protection Shed (interior). The presence of carbonation was not unusual considering the age and exposure conditions of the structures.

The plaster sample analyzed from the Bath and Locker House was a gypsum-based material (Photos 20 and 21). This is typical plaster material. The gypsum board sample was analyzed similar to the mortars. There was an indication that gypsum was present, but it was not quantified.

The gypsum board was analyzed chemically and was determined to be a lime and sand mixture, with a binder to sand ratio of approximately 1 to 0.7.

Conclusions

The masonry units of the structures observed were similar in appearance and were in good condition. Deterioration in the form of cracks was not observed. Significant efflorescence staining was not observed on the masonry units.

The mortars observed were competent and did not crumble or break easily. The mortar was difficult to excavate at most locations. The mortar was intact in most locations and was not easily scratched with a metal chisel. The mortar observed was light gray to medium gray in color. The sand observed was a natural sand composed of quartz and other hard siliceous minerals. The mortar joints were well tooled and concave in shape. Freeze-thaw damage was not observed.

New mortar was observed on the exterior wall of Hangar No. 1. The mortar was white in color and had a brown smear coat applied to the surface. The brown coating provided a means of matching it to the existing mortar. LAW understands this area was re-constructed in the summer of 2001. The new masonry work appeared to be in good condition.

Petrographic evaluations and field observations indicated the mortars were similar in composition. Chemical analysis indicated the mortars ranged from a Type M to Type O based on ASTM C270 Proportion Specifications. The mortars were generally Types S and N, but an occasional Type M and O were observed. If re-pointing of the existing masonry is performed in the future, it is LAW's opinion that a reasonably strong mortar can be used without damaging the units. Softer mortars may result in increased watertightness in the mortar and better bond to the masonry units. A Type N mortar would be appropriate for most pointing purposes at the site.

The plaster sample analyzed from the Bath and Locker House was a gypsum-based material. This is typical plaster material. The gypsum board sample was analyzed similar to the mortars. There


March 28, 2002


was an indication that gypsum was present, but it was not quantified. The gypsum board was determined to be a lime and sand mixture, with a binder to sand ratio of approximately 1 to 0.7.

LAW appreciates the opportunity to have worked with you on this project. If you have any questions about this report, please do not hesitate to contact the undersigned.

Sincerely,

LAW ENGINEERING AND ENVIRONMENTAL SERVICES, INC.


Marian D. Strukel
Project Engineer *by MSL
w/permission*


Mark E. Leeman, P.E. (Georgia)
Principal Engineer

Attachments: Photographs
Moton Field Layout
Table 1 – ASTM C1324 Chemical Evaluation Results
Table 2 – Calculated Mortar Proportions

File: g:/lab/mstrukel/moton



Photo 1. Control Tower Building



Photo 2. Control Tower Building – West Face



Photo 3. Control Tower Building – Interior North Face

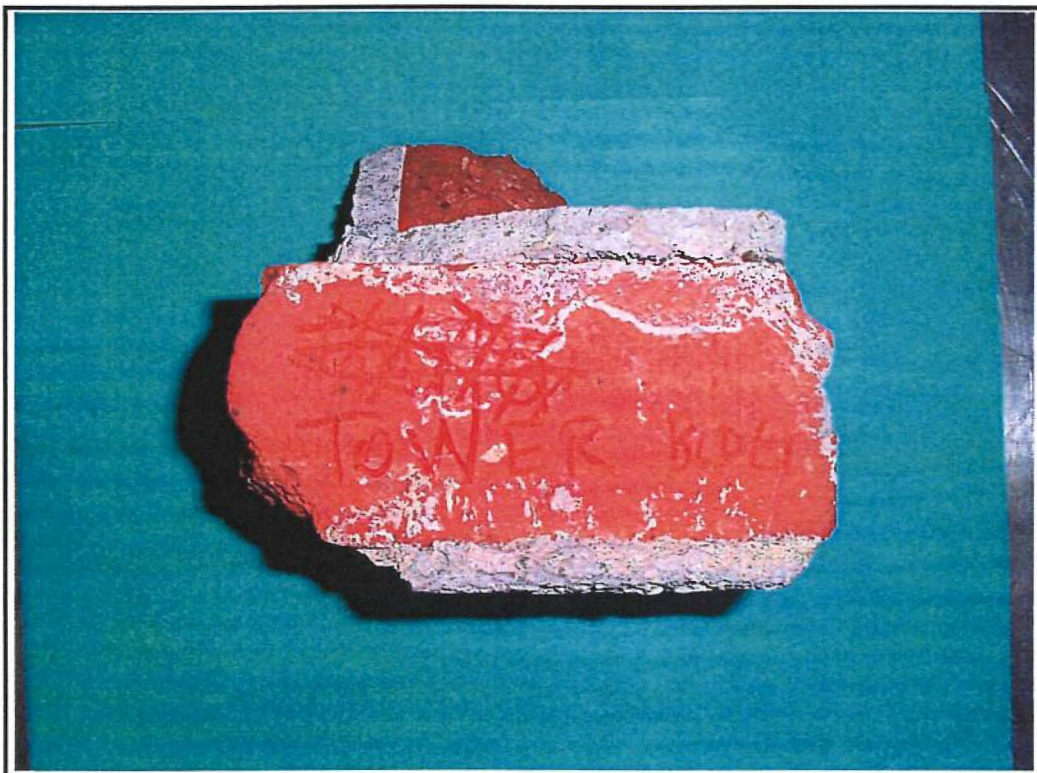


Photo 4. Brick/Mortar sample taken from exterior of Control Tower Building

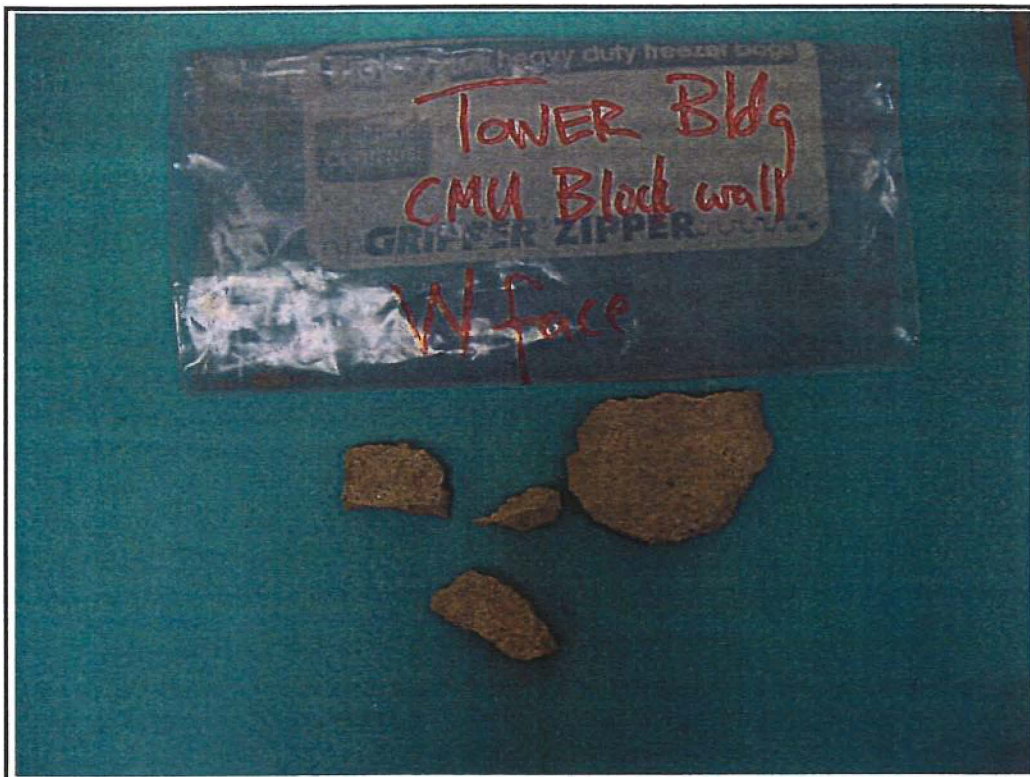


Photo 5. Mortar samples from Control Tower – exterior west face of building

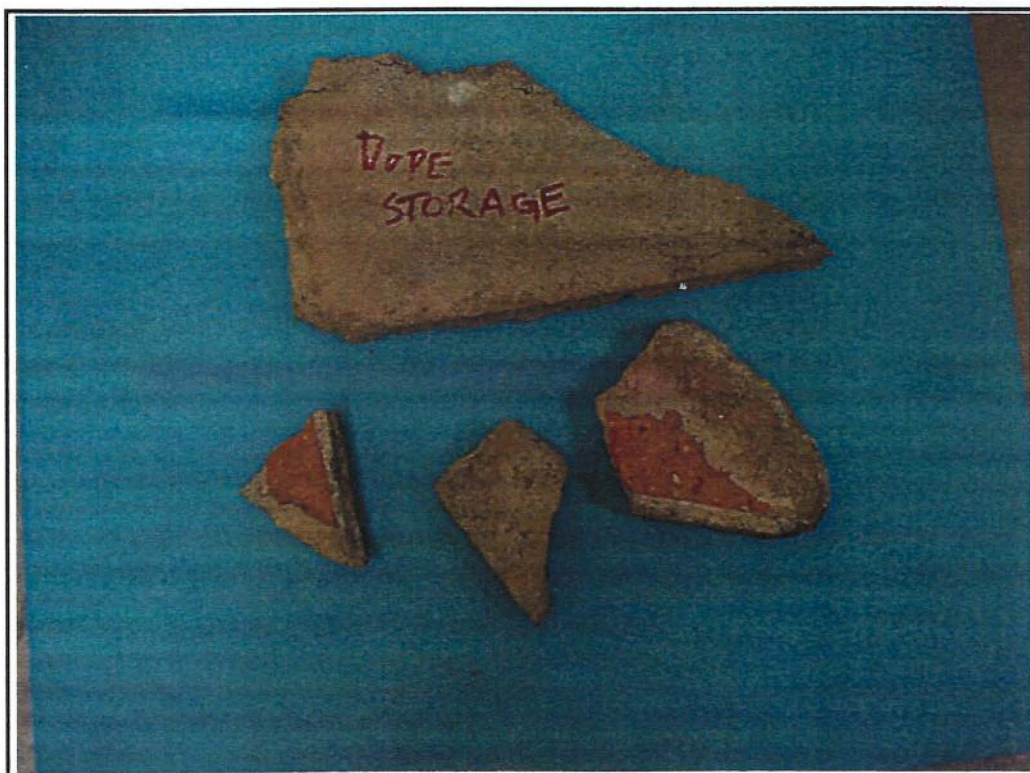


Photo 6. Mortar/Brick samples taken from interior of Dope Storage Shed



Photo 7. Hangar No. 1 – East Face

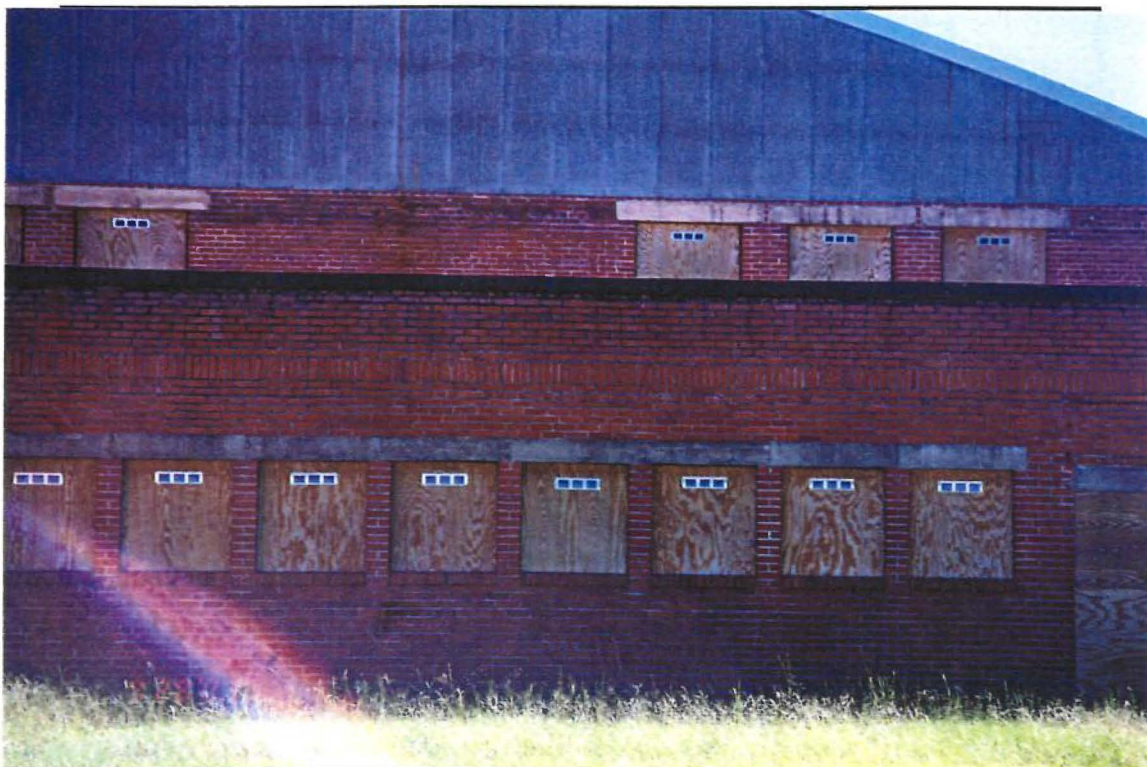


Photo 8. Hangar No. 1 – West Face



Photo 9. Hangar No. 1 – South Face



Photo 10. Hangar No. 1, Interior – Parge coat mortar observed on structural clay tile and masonry surfaces.



Photo 11. Hangar No. 1, Interior – Parge coat mortar observed. Note sand particles on surface poorly bonded to mortar.

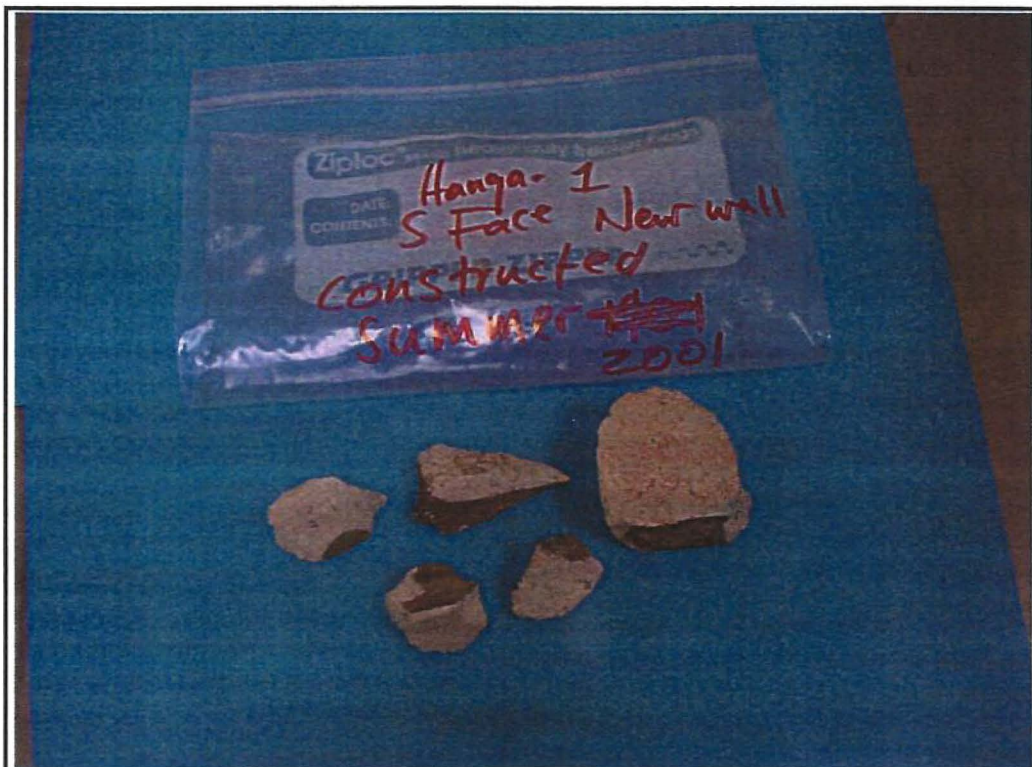


Photo 12. Hangar No. 1, Exterior South Face – Mortar samples taken from new construction. Note white mortar color (A) and brown smear coat (B) on tooled joint surface.

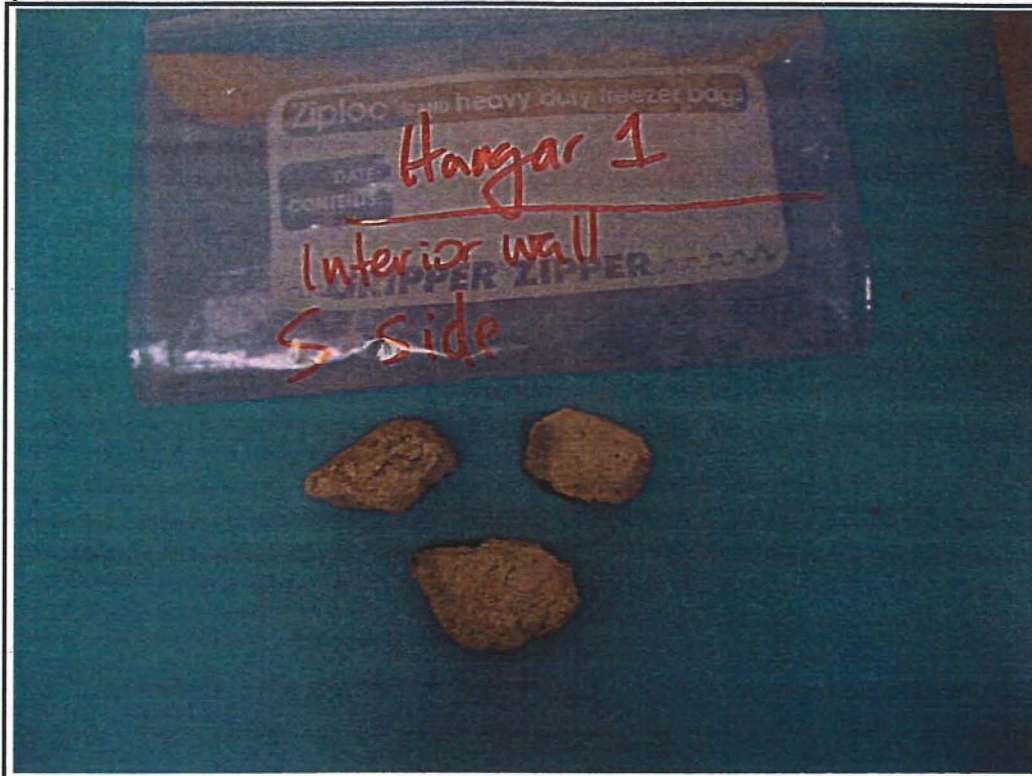


Photo 13. Hangar No. 1, Interior South Side– Mortar taken from brick



Photo 14. Fire Protection Shed – East Face



Photo 15. Fire Protection Shed – Interior face beside door. Note cracked mortar.

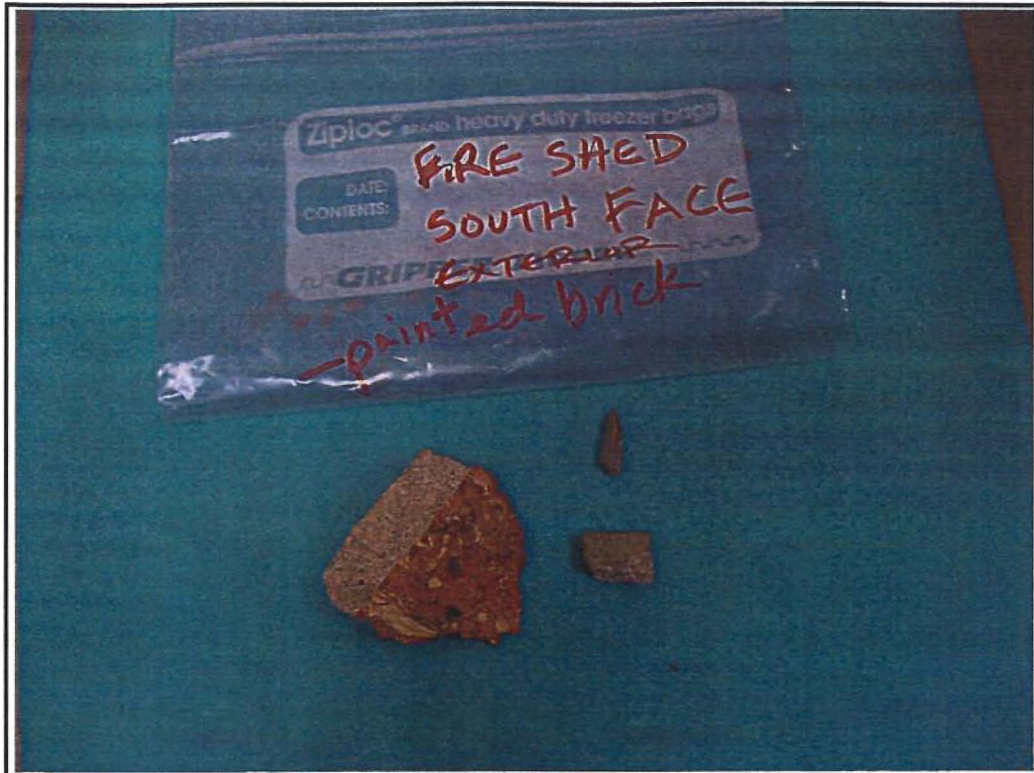


Photo 16. Fire Protection Shed – Mortar/brick samples from south face. Brick painted on side not shown.

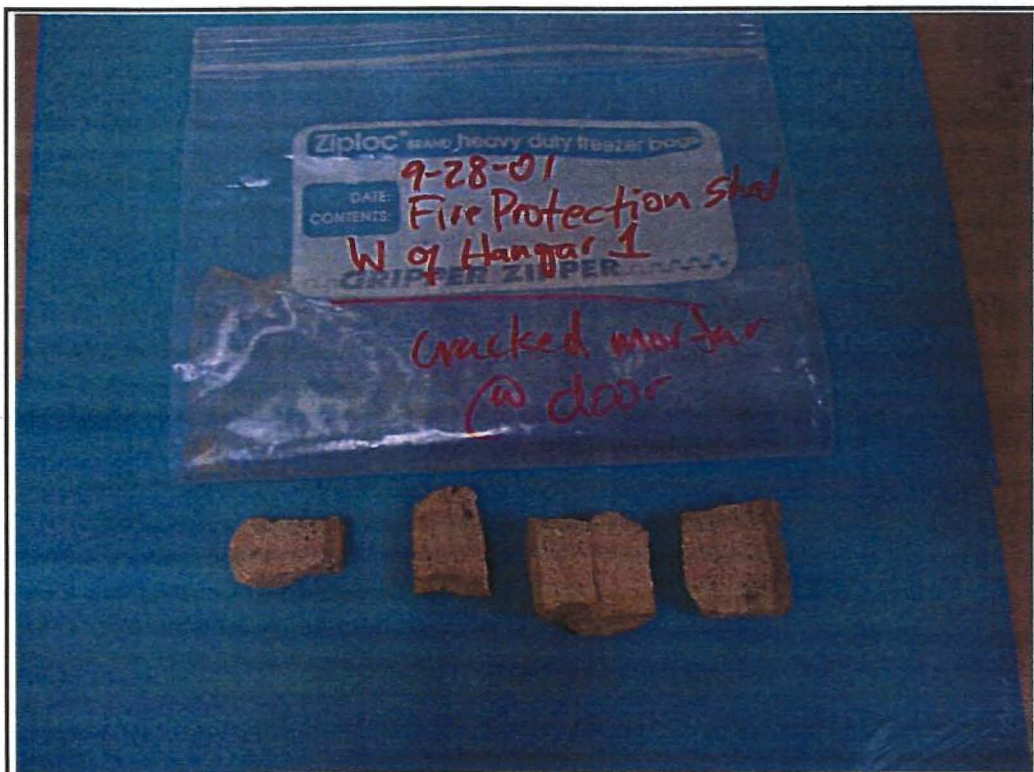


Photo 17. Fire Protection Shed – Interior cracked mortar at door. Note mortar discoloration at surface (extending approximately $\frac{1}{4}$ inch from surface).



Photo 18. Bath and Locker House – East Face



Photo 19. Bath and Locker House – West Face

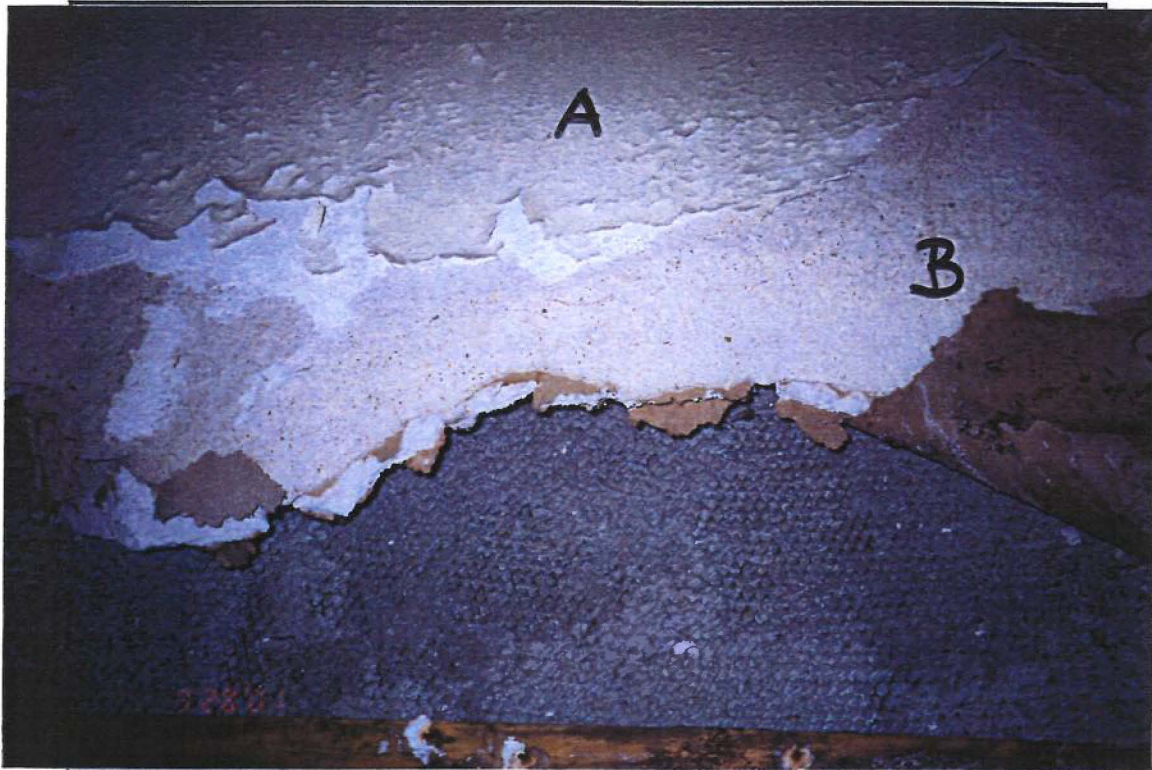


Photo 20. Bath and Locker House – Interior, Plaster (A) and gypsum board (B)


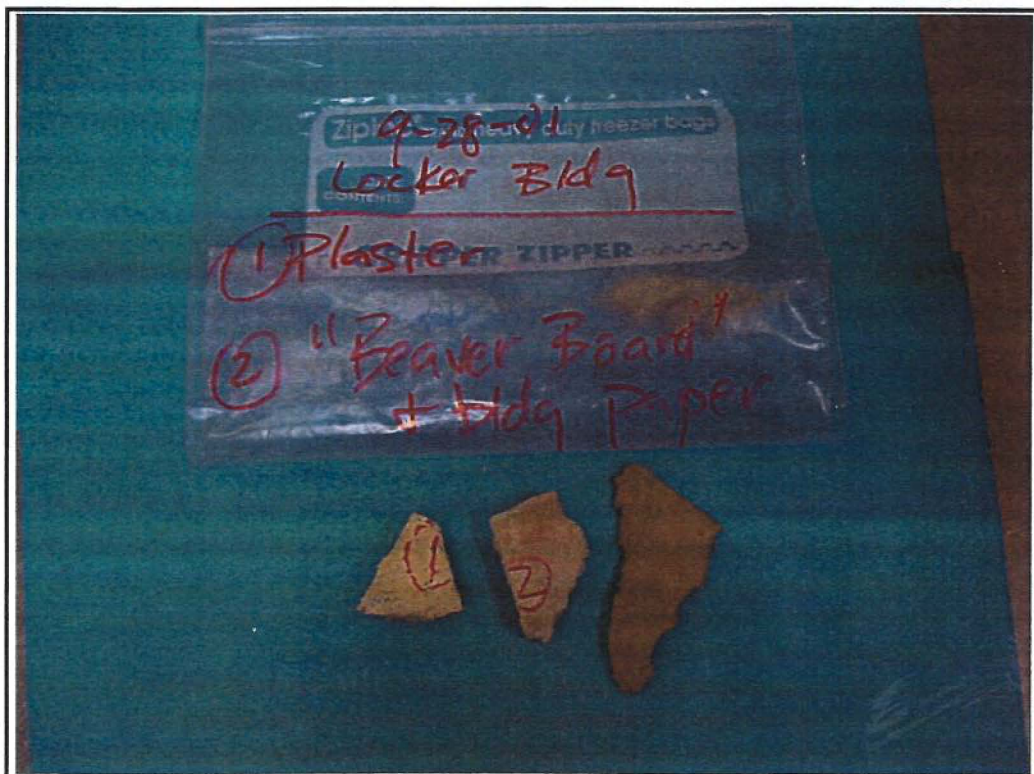


Photo 21. Bath and Locker House – Samples of Plaster (1) and gypsum board (2) with building paper (3)



Photo 22. Skyway Club – East Face

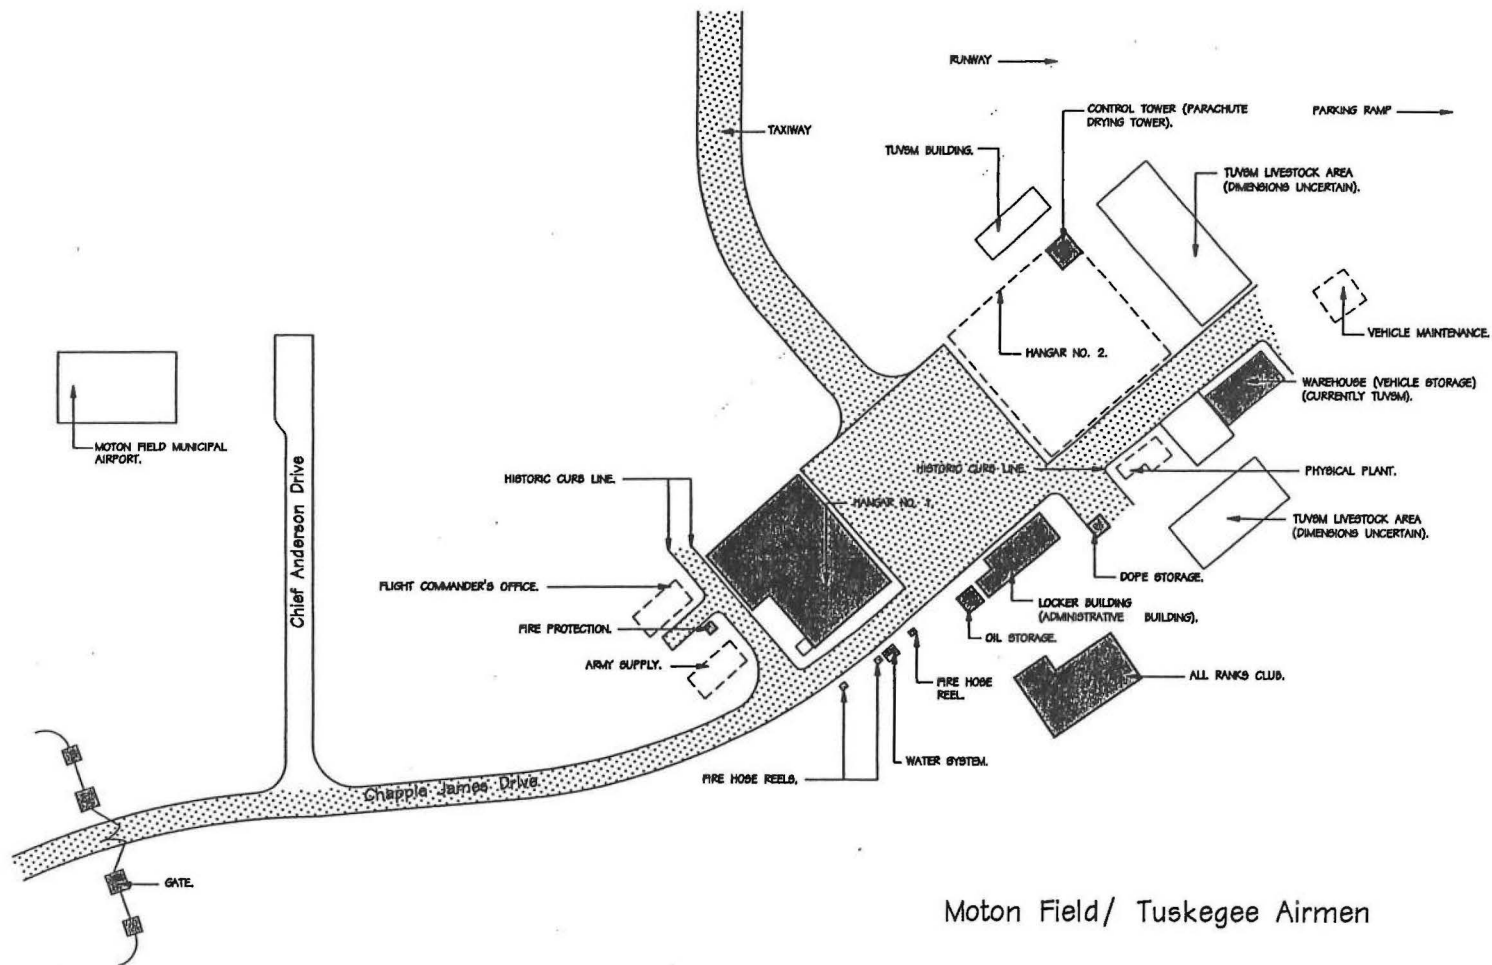

SITE PLAN
SCALE: N.T.S.

Moton Field/ Tuskegee Airmen

SEAL	BOND Architects & Engineers 2000 Century Parkway Dallas, Texas 75201 Atlanta, Georgia 30308 404.525.2000 FAX 404.525.2001	DESIGNED:	SUB SHEET NO.	TITLE OF SHEET	DRAWING NO.			
		DRD				C1	SITE PLAN	459 80,016
		CADD:						
		DRD						
		TECH. REVIEW:						
		RAS						
		DATE:						
		03/15/00						

MOTON FIELD STABILIZATION
TUSKEGEE AIRMEN NAT'L HISTORIC SITE
TUSKEGEE, ALABAMA

PKG. NO. SHEET
OF 52

Table 1: ASTM C1324 Chemical Evaluation Results

Chemical Analysis (%)	Dope Strg Int. Wall	Hangar 1 New Const	Hangar 1 S. Int.wall	Locker Blg Beaver Brd	Locker Blg Plaster	Fire Shed W.of Hang 1	Fire Shed S. Exterior	Tower Blg Ext. W.Face
Soluble SiO ₂	3.36	4.28	4.99	0.26	0.84	3.87	2.85	3.83
Soluble CaO	18.32	22.15	15.6	26.15	15.82	14.36	13.62	15.24
Soluble MgO	1.02	0.66	0.74	1.65	2.92	0.45	0.8	2.49
Insoluble	62.25	63.73	65.95	46.61	64.75	67.01	68.72	65.2
Total Solids	84.95	90.82	87.28	74.67	84.33	85.69	85.99	86.76
LOI 110C (free water)	0.87	3.24	0.89	2.01	1.75	0.86	0.7	1.02
LOI 550C (combined water)	2.63	3.65	2.27	19.29	7.23	2.53	4.11	4.28
LOI 950C (carbonates)	10.23	4.79	8.6	2.01	3.82	7.95	8.54	6.57
Total	98.68	102.5	99.04	97.98	97.13	97.03	99.34	98.63
ASTM C1218M Water Soluble Sulfate (SO ₄)					11.79			

Table 2: Calculated Mortar Proportions

Constituent	<u>Volume by Parts</u>							
	Dope Strg	Hangar 1	Hangar 1	Locker Blg	Locker Blg	Fire Shed	Fire Shed	Tower Blg
	Int. Wall	New Const	S. Int.wall	Beaver Brd	Plaster	W.of Hang1	S. Exterior	Ext. W.Face
portland cement	1.0	1.0	1.0	1.0	1.0	1.0	1.0	1.0
lime	1.6	1.4	0.1	63.6	10.3	0.4	1.1	0.6
sand	4.6	3.7	3.3	44.2	19.0	4.3	5.9	4.2
total cemeticious	1.0	1.0	1.0	1.0	1.0	1.0	1.0	1.0
sand	1.8	1.5	3.1	0.7	1.7	3.0	2.8	2.6
ASTM C270 Type	O	S*	M			S	N	N

* Based on masonry cement