

Singer's Lake Crescent Tavern (Lake Crescent Lodge),
Lodge Building (Bldg. No. 654)
Barnes Point, Lake Crescent
Olympic National Park
Port Angeles Vicinity
Clallam County
Washington

HABS No. WA-186-A

HABS
WASH.
S-POAN.V,
1-A-

PHOTOGRAPHS

WRITTEN HISTORICAL AND DESCRIPTIVE DATA

HISTORIC AMERICAN BUILDINGS SURVEY
NATIONAL PARK SERVICE
PACIFIC NORTHWEST REGION
DEPARTMENT OF INTERIOR
SEATTLE, WASHINGTON

PNR-100 6/82

**PNRO
INVENTORY**National Park Service
Pacific Northwest Region
Cultural Resources DivisionWestin Building, Room 1920
2001 Sixth Avenue
Seattle, Washington 98121

1. SITE I.D. NO		2. NAME(S) OF STRUCTURE 654 LODGE BUILDING (Singer's Tavern)		5. ORIGINAL USE Resort Lodge		7. CLASSIFICATION		2. RATING	
3. SITE ADDRESS (STREET & NO) Barnes Point; Lake Crescent; Highway 101		6. PRESENT USE Seasonal Resort Lodge						10. DATE 1914-15/ 1949	
4. CITY/VICINITY Approx. 20 miles S.W. of Port Angeles, Clallam, Washington		8. UTM ZONE 10		EASTING 440550		NORTHING 5322000		11. REGION PNR	
12. OWNER/ADMIN ADDRESS Department of the Interior, National Park Service, Olympic National Park, 600 East Park Ave., Port Angeles, WA 98362		SCALE 1:24 OTHER		(1:625)		QUAD NAME Lake Crescent			
13. DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S), PHYSICAL DIMENSIONS, MATERIALS, MAJOR ALTERATIONS, EXISTANT EQUIPMENT, AND IMPORTANT BUILDERS, ARCHITECTS, ENGINEERS, ETC. The main lodge building at Singer's Lake Crescent Tavern is one of the earliest constructed structures in the resort complex. The original lodge was completed in 1915, along with twenty small sleeping cabins. In the late 1910s or early 1920s, a one-story addition was completed, doubling the size of the present dining room. In 1949, a major two-story addition was constructed on the south side of the existing lodge. Periodically, several small alterations have been made to the rear southeast section of the building. Since establishment of the resort, the main lodge has housed dining facilities and been the focal point of numerous social events and business meetings, including a 1937 meeting where President Franklin Roosevelt and key public officials engaged in discussions leading to the establishment of Olympic National Park. Irregular in shape; measures 57' x 36' with 11'6" x 56' glass-enclosed porch on north elevation; porch on east elevation measures 12' x 48'; rebuilt kitchen wing measures 40' x 33'. Other than 1 story dining room wing, the overall lodge is 2 1/2 stories; wall construction is wood-frame; siding is wood shingles (painted); multi-gabled roof with wood shingles; hip roof on wrap around porch; post and pier foundation; multi-light casement windows; multi-light main entrance door; wrap around veranda with north elevation portion enclosed with multi-light windows; 4 gable roof dormers with casement windows; large field stone chimney on N.W. elevation. Alterations: addition of a									
14. CONDITION ☐ EXCELLENT ☒ GOOD ☐ FAIR ☐ DETERIORATED ☐ RUINS									
15. DANGER OF DEMOLITION? (SPECIFY THREAT) ☐ YES ☒ NO ☐ UNKNOWN									

REMARKS (Item No. 13 continued)

compatible, 2-story wing on the west wall of main lodge in 1949; kitchen remodeled in 1949. Siting: approx. 15-20 yds. from the Lake Crescent shoreline in a grove of trees; part of the Singer's Tavern Group.

16. SIGNIFICANCE

This building contributes to the integrity of design, workmanship, setting, and sense of time and place of Singer's Tavern Group.


Singer's Lake Crescent Tavern (Lake Crescent Lodge), Lodge Building (Bldg. No. 654)

HABS No. WA-186-A

(Page 1)

HABS
WASH
S-POA
1-A-

17. PHOTOS AND SKETCH MAP OF LOCATION

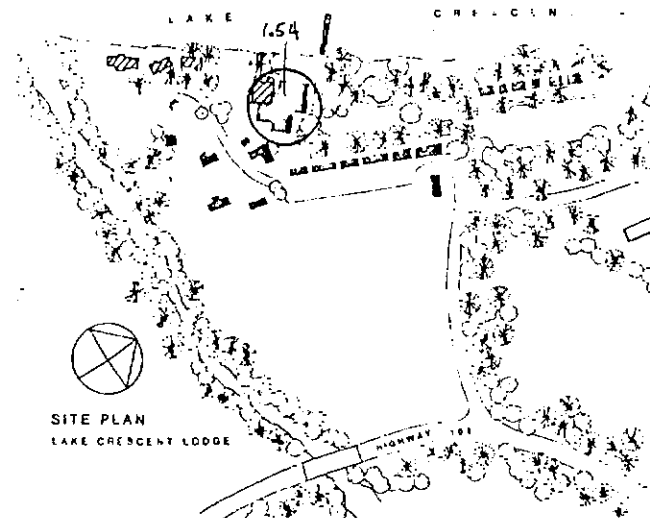


NEG. 2:1A

18. LOCATED IN AN HISTORIC DISTRICT?		☐ YES	☒ NO	☐ NAME
19. PUBLIC ACCESSIBILITY		☒ YES, LIMITED	☐ YES, UNLIMITED	
		☐ NO	☐ UNKNOWN	
20. EXISTING SURVEYS		☐ NR	☐ NHL	☐ HABS
		☒ COUNTY	☐ LOCAL	☒ OTHER
		☐ HAER-1	☐ HAER	☒ NPS
		☐ STATE		
21. REFERENCES—HISTORICAL REFERENCES, PERSONAL CONTACTS, AND/OR OTHER				

Florence, Hank, Cathy Gilbert and Gail Evans. 1984. "Historic Structures Report: Lake Crescent Lodge."
National Park Service, Pacific Northwest Region.


22. INVENTORIED BY	Leslie Helm / Gail Evans	AFFILIATION	National Park Service	DATE	9/82, 1984
--------------------	--------------------------	-------------	-----------------------	------	------------

ELEVATIONS

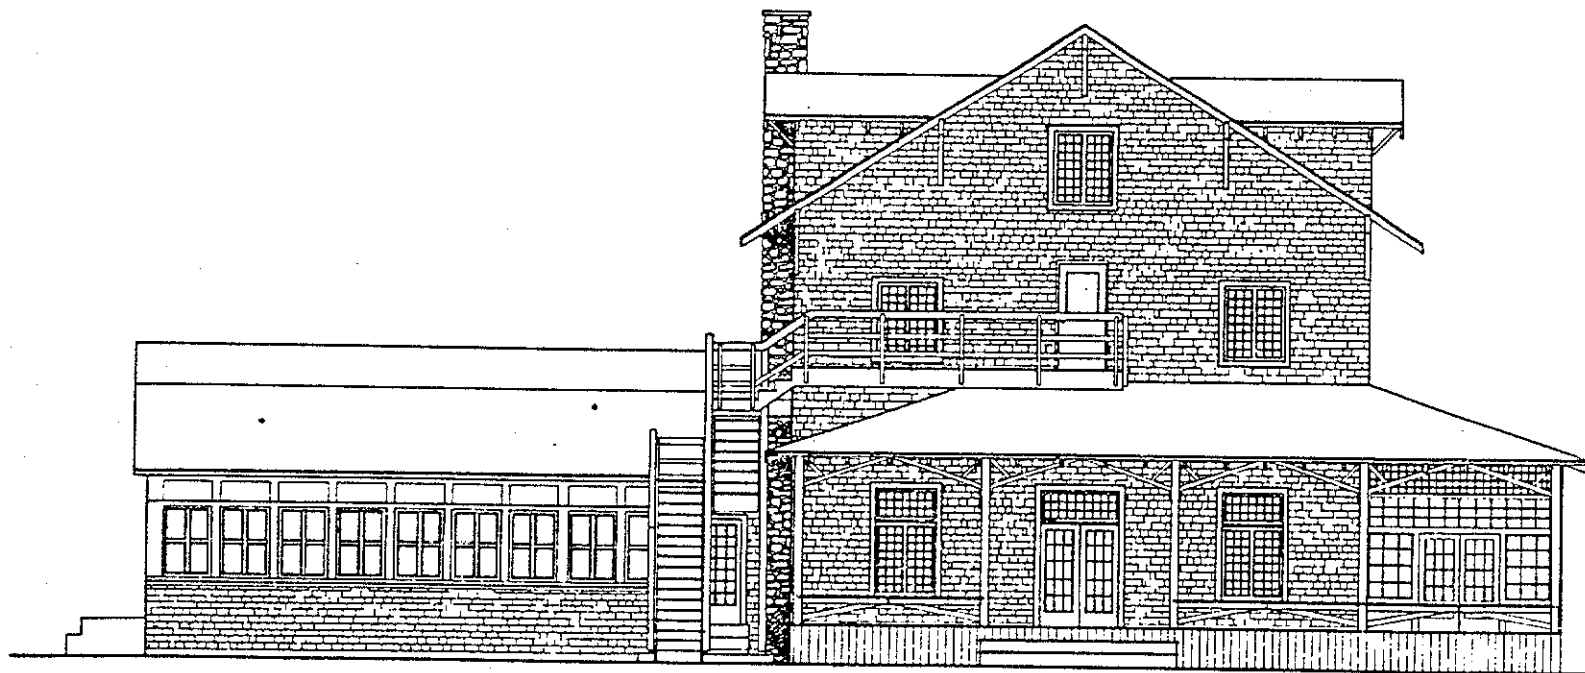


EAST ELEVATION

SCALE: 3/32" 1'0"

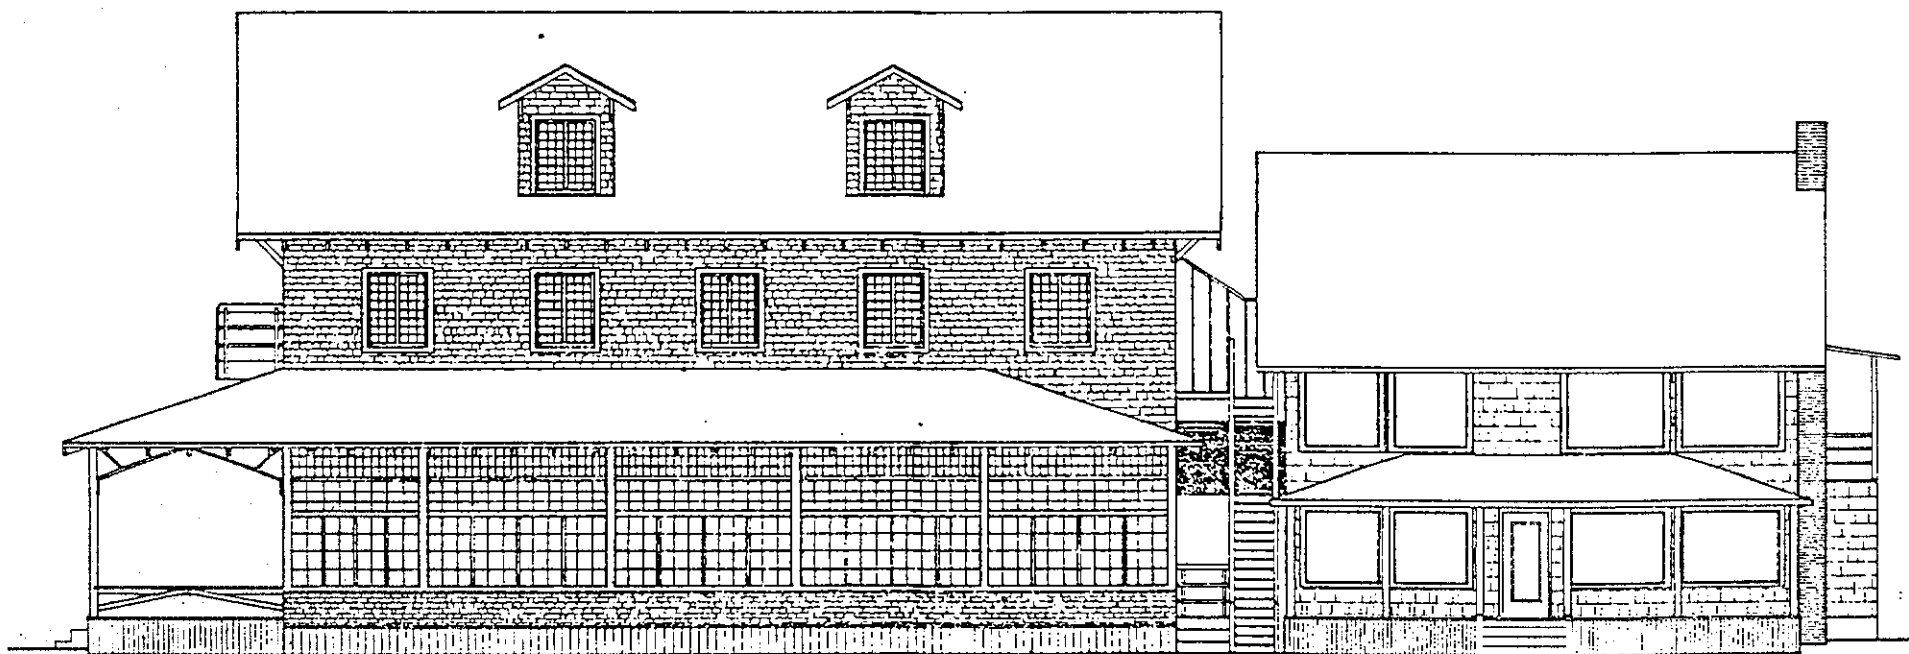


NORTH ELEVATION

SCALE: 3/32" 1'0"

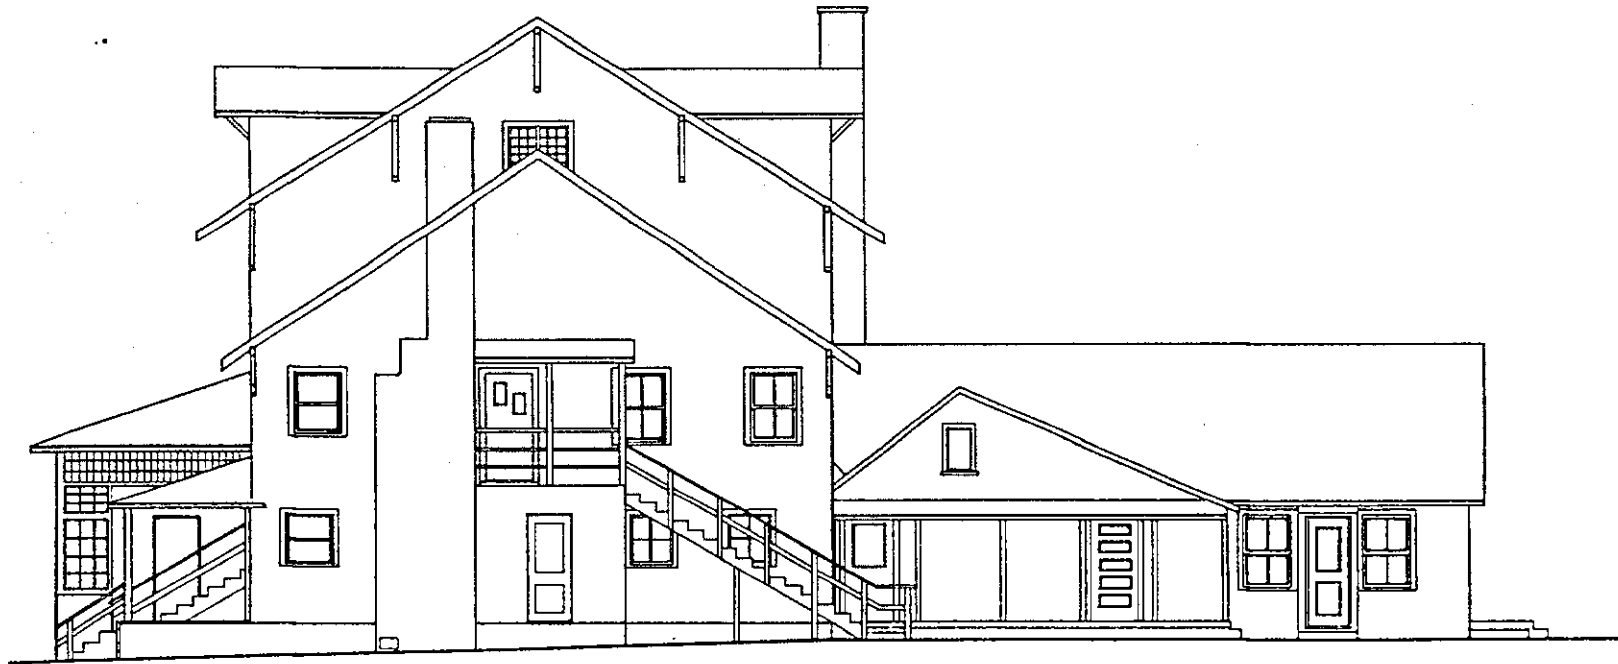


WEST ELEVATION

SCALE: 3/32" 1'0"

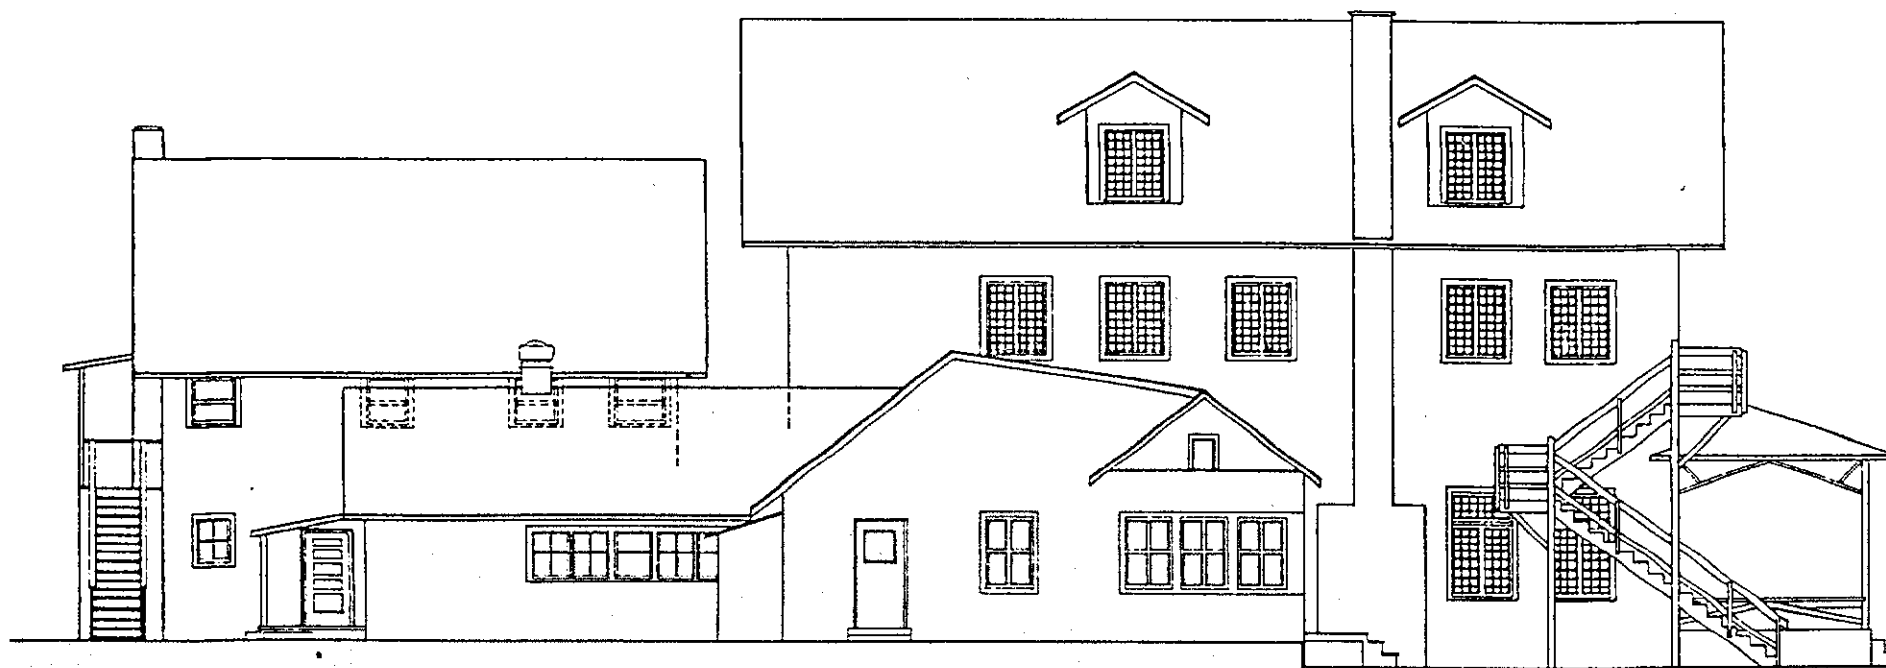


SOUTH ELEVATION


SCALE: 3/32" 1'0"

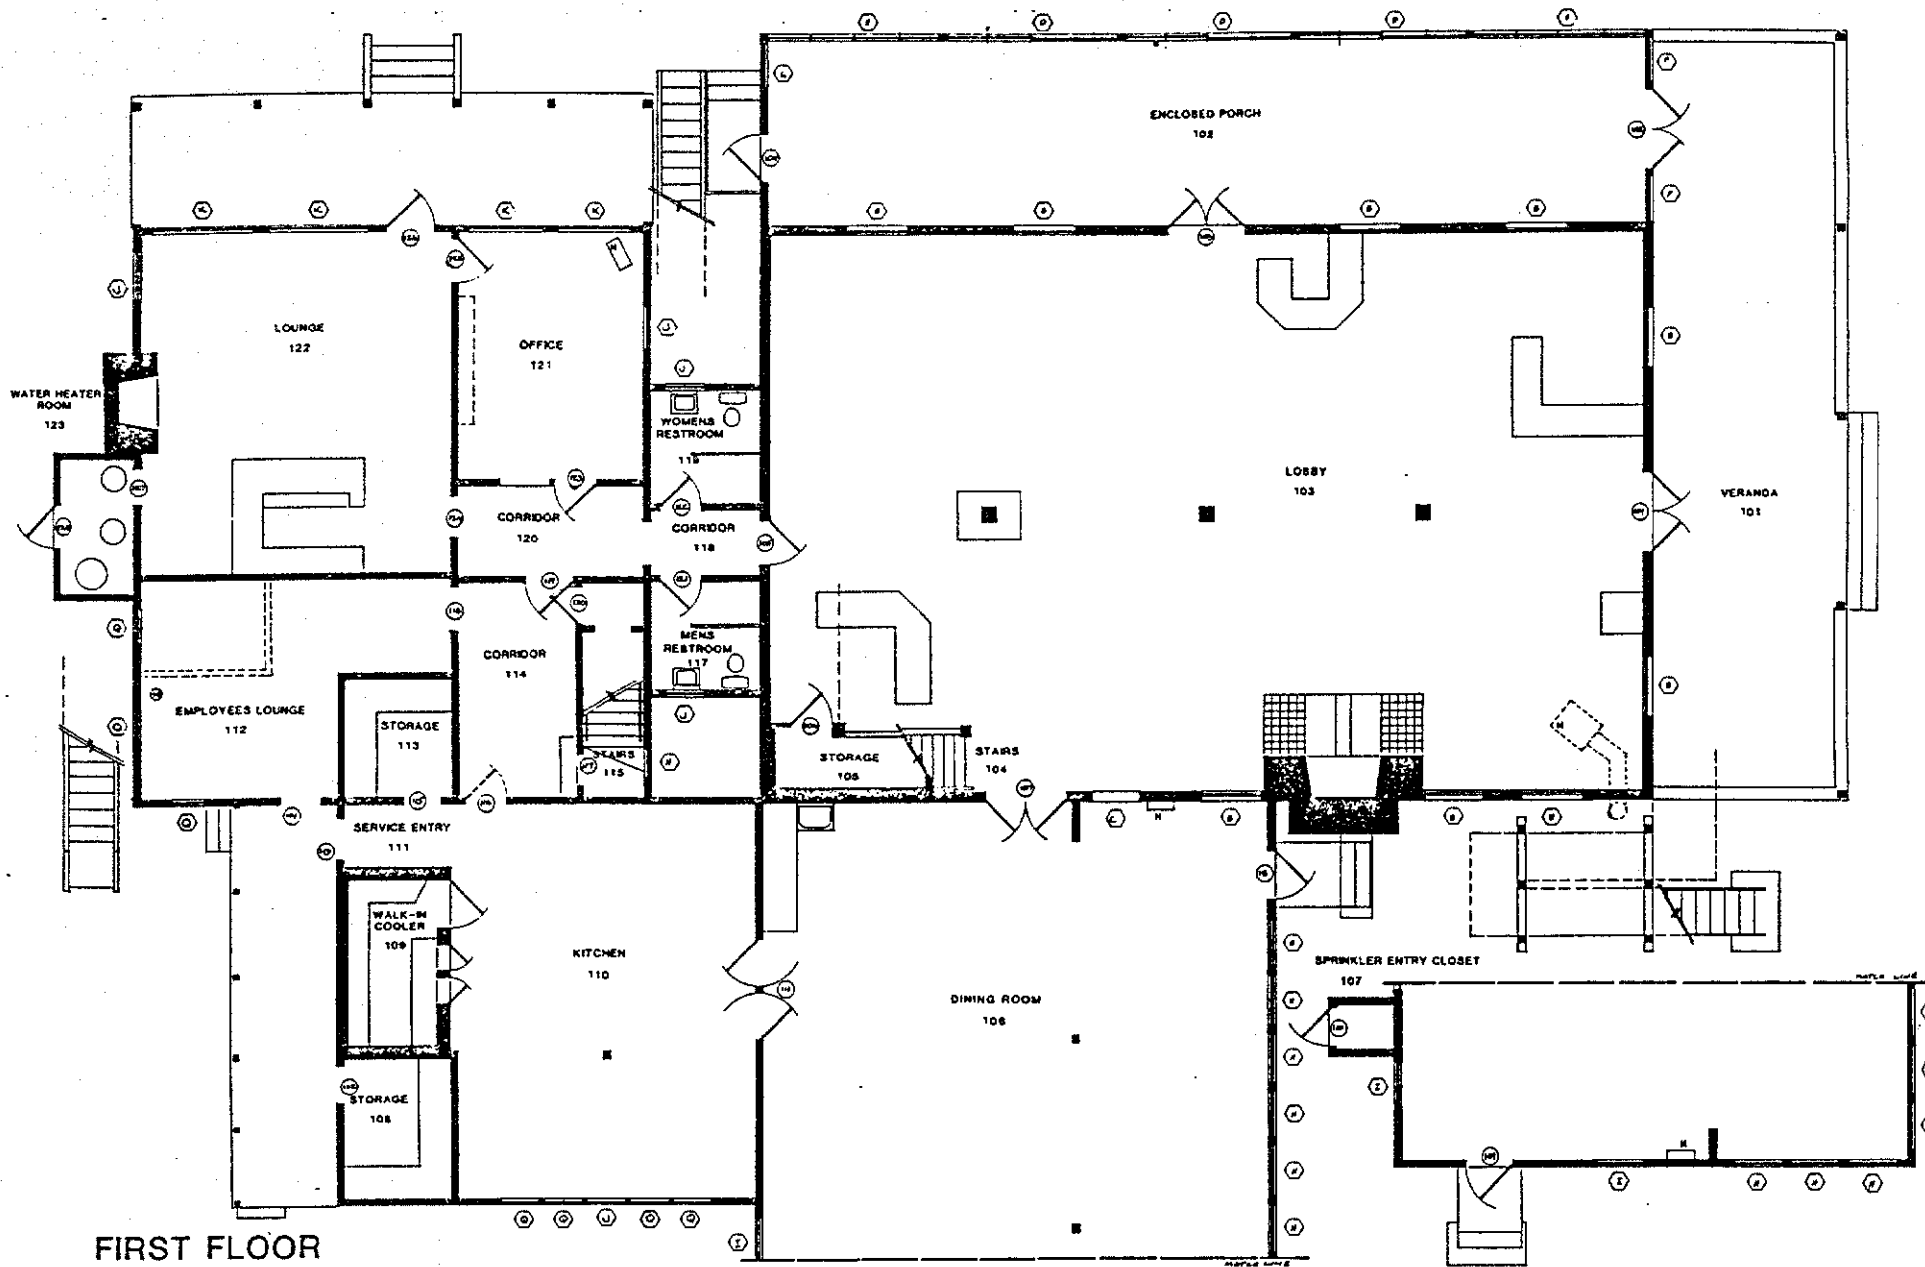

FIRST FLOOR

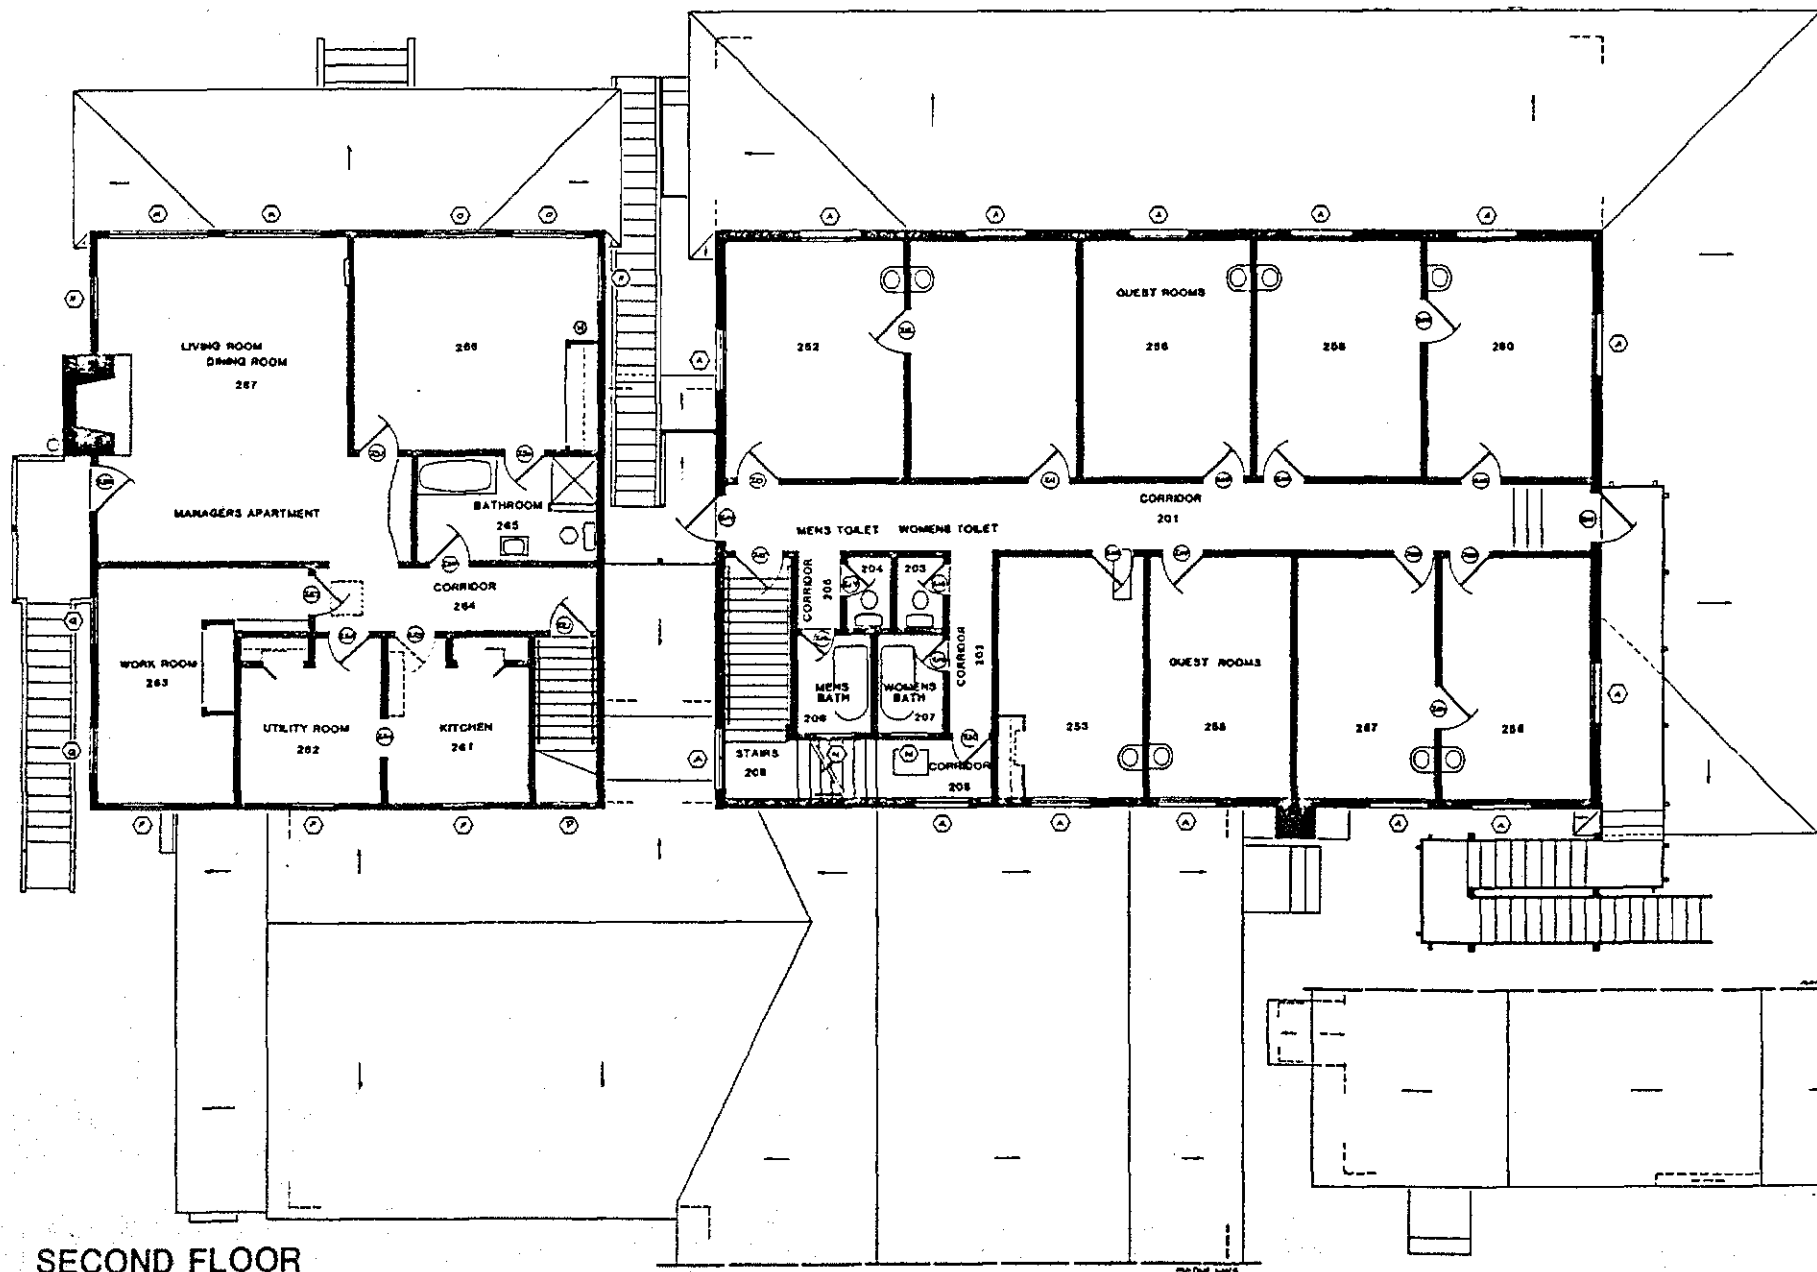

SECOND FLOOR

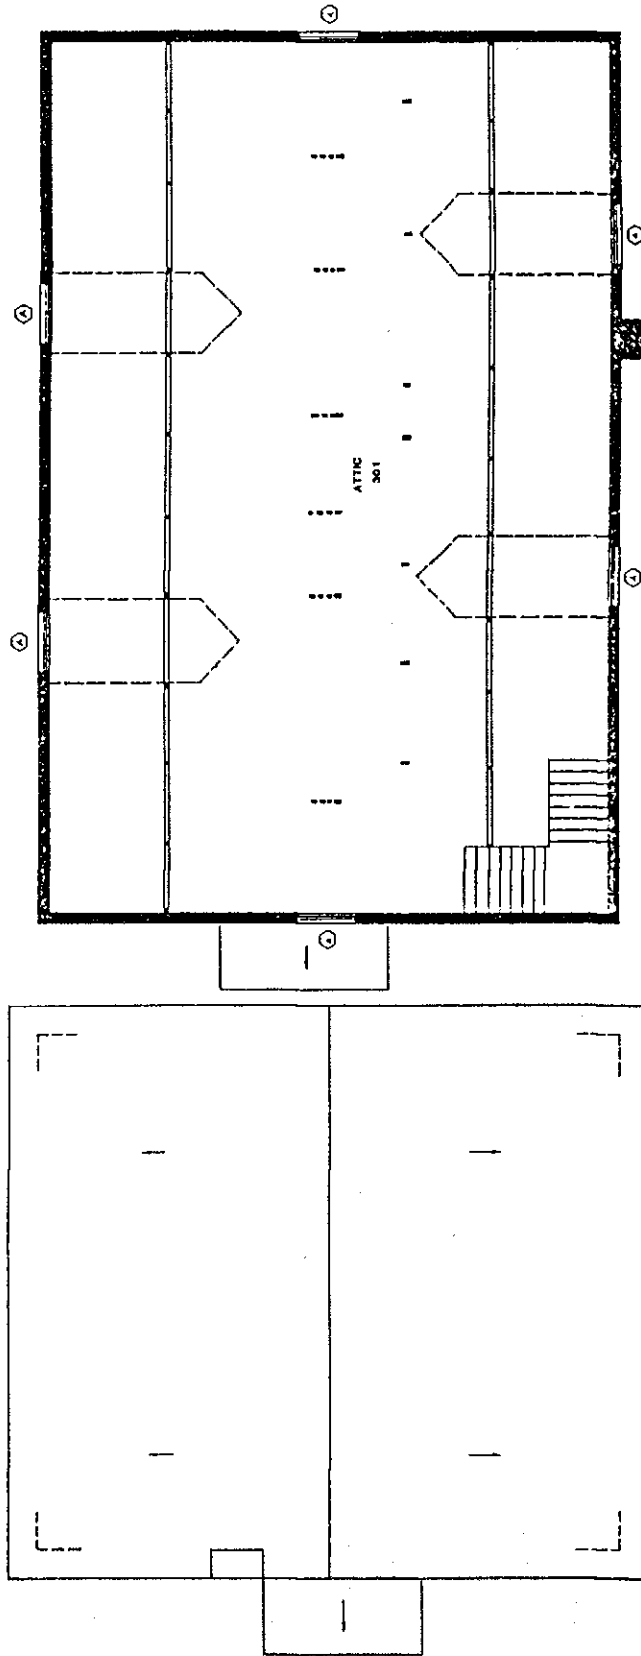

ATTIC

HABS
WASH,
S-POAN.V,
1-A-

HISTORIC AMERICAN BUILDINGS SURVEY

INDEX TO PHOTOCRAPHS

Singer's Lake Crescent Tavern (Lake Crescent Lodge),
Lodge Building (Bldg. No. 654)
Barnes Point, Lake Crescent
Olympic National Park
Port Angeles Vicinity
Clallam County
Washington

HABS No. WA-186-A

Marty Stupich, Photographer Summer 1983

NOTE: These photographs are full-frame 4" x 5" enlargements from 2-1/4" x 2-1/4" negatives.

- WA-186-A-1 NORTHEAST FACADE, LOOKING SOUTHWEST
- WA-186-A-2 NORTHWEST FACADE, LOOKING SOUTHEAST
- WA-186-A-3 SOUTHWEST FACADE, LOOKING NORTHEAST
- WA-186-A-4 SOUTHEAST FACADE, LOOKING NORTHWEST
- WA-186-A-5 NORTHEAST FACADE OF REAR ADDITION, LOOKING SOUTHWEST
- WA-186-A-6 SOUTHEAST FACADE, LOOKING NORTHWEST
- WA-186-A-7 INTERIOR OF CLASS-ENCLOSED PORCH, LOOKING SOUTHWEST
- WA-186-A-8 INTERIOR OF CLASS-ENCLOSED PORCH, LOOKING NORTHEAST

NOTE: For additional written historical and descriptive data, please see the main entry for Singer's Lake Crescent Tavern (Lake Crescent Lodge), HABS No. WA-186.

CLYM 654 VIEW 6
HABS NO. WA-186-A-1



HABS NO. WA-186-A-1

OLYM 654 VIEW 7



HABS No. WA-186-A-2

OLYM 654 VIEW 10



HABS No. WA-186-A-3

OLYM 654, VIEW 11



HABS No. WA-186-A-4

OLYM 654

VIEW 15



HABS NO. WA-186-A-5

OLYM 654 VIEW 13



HABS NO. WA-186-A-6

OLYM 654 VIEW 8



HABS NO. WA-156-A-7

OLYM 654 VIEW 9



HABS No. WA-186-A-B