

Geraldine Lucas Homestead,  
Guest Cabin  
On west bank of Cottonwood Creek approximately  
2 1/2 miles downstream of Jenny Lake  
Moose Vicinity  
Teton County  
Wyoming

HABS No. WY-113-E

HABS  
WYO  
20-MOOS.V,  
7E-

PHOTOGRAPHS

WRITTEN HISTORICAL AND DESCRIPTIVE DATA

Historic American Building Survey  
National Park Service  
Rocky Mountain Regional Office  
Department of the Interior  
P.O. Box 25287  
Denver, Colorado 80225

HISTORIC AMERICAN BUILDING SURVEY  
GERALDINE LUCAS HOMESTEAD, GUEST CABIN

HABS NO. WY-113-E

(Page 1)

HABS  
WYD  
20-MOOLY  
7E-

Guest Cabin (WY-113-E):

A. General statement: Guest Cabin

1. Architectural character: This small structure is a one story, rectangular wood vernacular cabin.
2. Condition of fabric: The overall condition of this cabin is very poor as both the interior and exterior building materials are heavy deteriorated.



B. Description of exterior:

1. Overall dimensions: 12'-6" by 14'-6"
2. Foundation: This structure does not have a foundation.
3. Walls: The walls of the cabin are half logs which run vertically.
4. Structural system: The cabin has a wood frame structural system.
5. Porch: This cabin's porch is uncovered and constructed of wood planks.
6. Openings:
  - a. Doorways and doors: The cabin has only one door, which is a brown stained five panel wood door with half log trim.
  - b. Windows: Both the southern and eastern walls have a single 6/6 pane sliding sash window with brown stained half log trim.
7. Roof:
  - a. Shape and covering: This cabin has a normal pitched front gable roof with asphalt roll roof covering.
  - b. Eaves: The rafter eave ends are exposed.

C. Description of interior:

1. Floor plan: This cabin is a single rectangular room.

2. Flooring: The flooring in the main cabin is wood floor boards.
3. Wall and ceiling finishes: All of the walls are particle board, which was installed in between the wood studs. The ceiling of the cabin is suspended and composed of a three foot by five foot wooden grid with panels of acoustical tile in between the wooden grid.
4. Openings:
  - a. Doorways and doors: The only door is a stained five panel wood door with plain trim.
  - b. Windows: The south and east walls both have a single 6/6 sliding sash window. The sills and trim to these windows are plain and brown stained.
5. Hardware: The door has butt hinges and a brass round door knob on a rectangular base, which may be original. There is also a box lock on the door.
6. Mechanical equipment: The cabin was heated by wood stove however, only the stove pipe remains. The electrical system is exposed rubber insulated wiring and the only light bulb hangs below the socket by its wires.

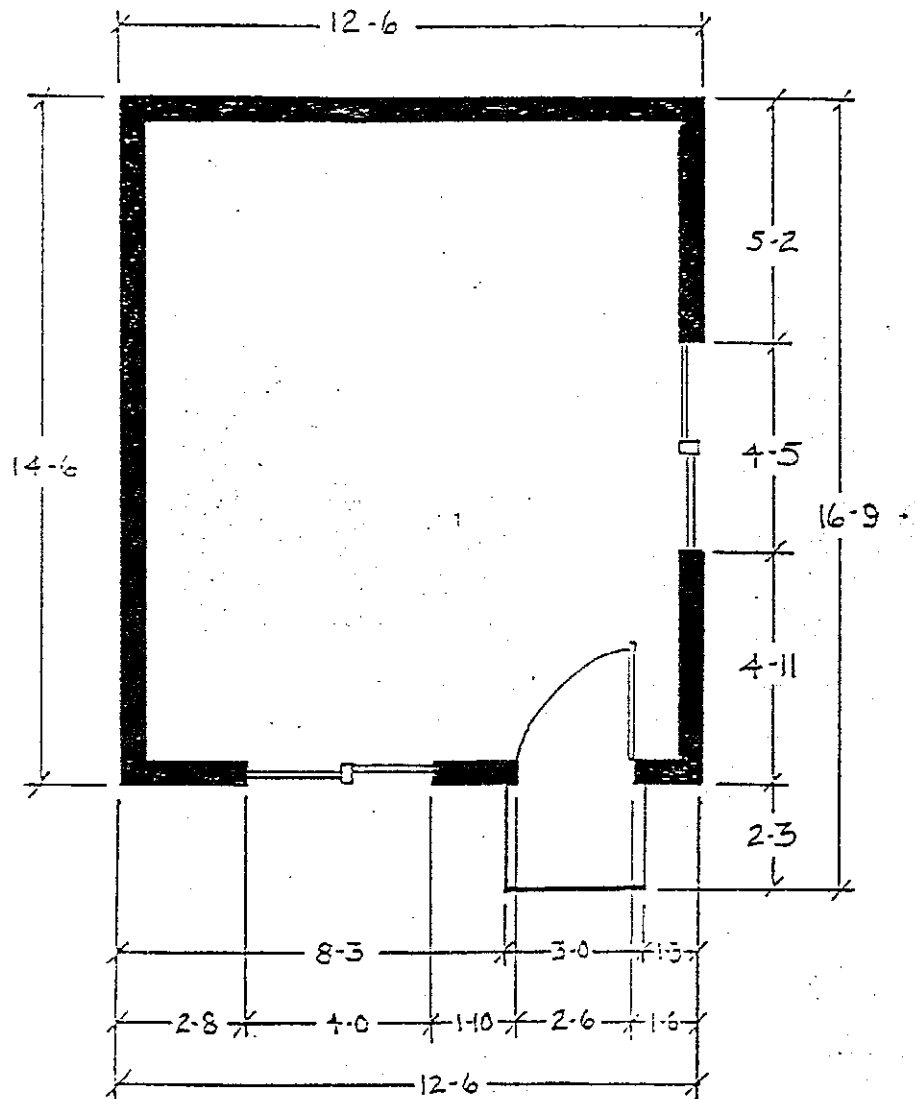

SCALE 1/4" = 1'-0"  
 0' 2'

HISTORIC AMERICAN BUILDINGS SURVEY

INDEX TO PHOTOGRAPHS

Geraldine Lucas Homestead,  
Guest Cabin  
On west bank of Cottonwood Creek approximately  
2 1/2 miles downstream of Jenny Lake  
Moose Vicinity  
Grand Teton National Park  
Teton County  
Wyoming

HABS No. WY-113-E

HABS  
WYO  
20-MOOS.V,  
TE-

Documentation:        2 exterior photographs  
                      3 data pages

Alan Bucknam, Photographer, June 1992

WY-113-E-1        GUEST CABIN, LOOKING NORTH.

WY-113-E-2        GUEST CABIN, LOOKING NORTH WEST.

HABS NO. WY-113-E-1





HAAS NB. WY-113-E-2