

Singer's Lake Crescent Tavern (Lake Crescent Lodge),
Cabins 22-31 (Bldg. Nos. 675-680)
Barnes Point, Lake Crescent
Olympic National Park
Port Angeles Vicinity
Clallam County
Washington

HABS No. WA-186-J

HABS
WASH.
5-POAN.V,
1-J-

PHOTOGRAPHS

WRITTEN HISTORICAL AND DESCRIPTIVE DATA

HISTORIC AMERICAN BUILDINGS SURVEY
NATIONAL PARK SERVICE
PACIFIC NORTHWEST REGION
DEPARTMENT OF INTERIOR
SEATTLE, WASHINGTON

PNR-100 6/82

**PNRO
INVENTORY**National Park Service
Pacific Northwest Region
Cultural Resources DivisionWestin Building, Room 1920
2001 Sixth Avenue
Seattle, Washington 98121

1. SITE I.D. NO. 		2. NAME(S) OF STRUCTURE 675 CABIN 22 & 23 (Singer's Tavern)		3. ORIGINAL USE Resort Cabins	4. CLASSIFICATION	5. RATING
3. SITE ADDRESS (STREET & NO.) Barnes Point; Lake Crescent; Highway 101		6. PRESENT USE Seasonal Resort Cabins		7. DATE c. 1919		
4. CITY/VICINITY Approx. 20 miles S.W. of Port Angeles, Clallam, Washington		5. STATE Washington		6. REGION PNR		
7. OWNER/ADMIN ADDRESS Department of the Interior, National Park Service, Olympic National Park, 600 East Park Ave., Port Angeles, WA 98362		8. UTM ZONE 10		9. EASTING 440575		
		10. NORTHING 5322875		11. SCALE 1:24 (1:625)		
				12. QUAD NAME Lake Crescent		

13. DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S), PHYSICAL DIMENSIONS, MATERIALS, MAJOR ALTERATIONS, EXISTANT EQUIPMENT, AND IMPORTANT BUILDERS, ARCHITECTS, ENGINEERS, ETC.

Cabin 22 and 23 is one of six sleeping cabins standing in a row north of the Singer's Lake Crescent Tavern main lodge and approximately 75 feet from the Lake Crescent shoreline. These cabins stand on the site of an earlier row of wood frame canvas tent cabins, erected soon after the establishment of Singer's resort. This cabin and its adjacent neighboring cabins were probably constructed around 1919. Unlike the row of six cabins directly east of the main lodge, these cabins have received more extensive alterations since their construction. Possibly in the 1940s the owner joined several cabins by constructing gambrel roofs over adjoining pairs. In the late 1960s or early 1970s, the existing wood board and batten siding was replaced with simulated board and batten paneling. Porches and interiors have also been replaced or remodeled over the years. In terms of scale, overall design, siting and landscaping, the entire row of cabins has maintained much of its original integrity. More importantly, Cabin 22 and 23, and its adjacent cabins, contribute to the overall feeling and ambience of Singer's Lake Crescent resort. Little is known of the social history of this cabin.

Rectangular in shape; measures 14' x 24' with 4' wide porch; 1 story; wood-frame wall construction; pressboard siding; gambrel roof with wood shingles; shed roof porch across main facade; single leaf, multi-light casement windows frame the two doors on the north elevation. Alterations: shed roof addition which cuts into existing window on rear

14. CONDITION	☐ EXCELLENT	☐ GOOD	☒ FAIR	☐ DETERIORATED	☐ RUINS	15. DANGER OF DEMOLITION? (SPECIFY THREAT)	☒ YES	☐ NO	☐ UNKNOWN
---------------	------------------------------------	-------------------------------	--	---------------------------------------	--------------------------------	--	---	-----------------------------	----------------------------------

RECOMMENDATION (Item No. 13 continued)



south elevation; probable joining of two gable roofs under existing gambrel roof. Siting: approx. five yards from Lake Crescent in row arrangement with other cabins; part of the Singer's Tavern building group.

16. SIGNIFICANCE

This building contributes to the integrity of design, workmanship, setting, and sense of time and place of Singer's Tavern group.

HABS
WASH.
5-POAN.A
1-J-

17. PHOTOS AND SKETCH MAP OF LOCATION

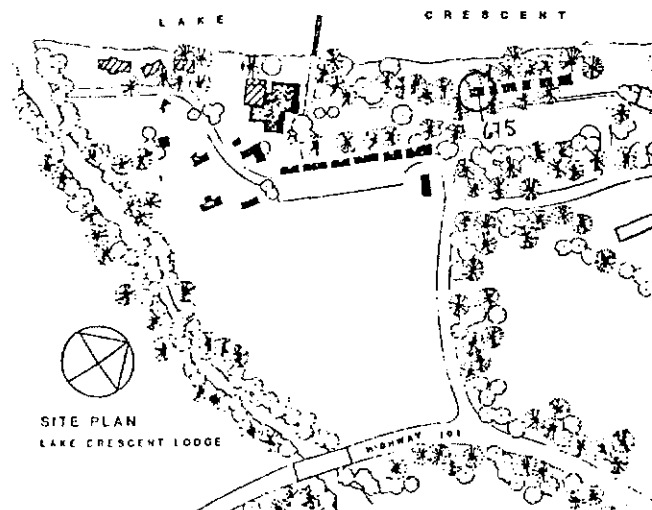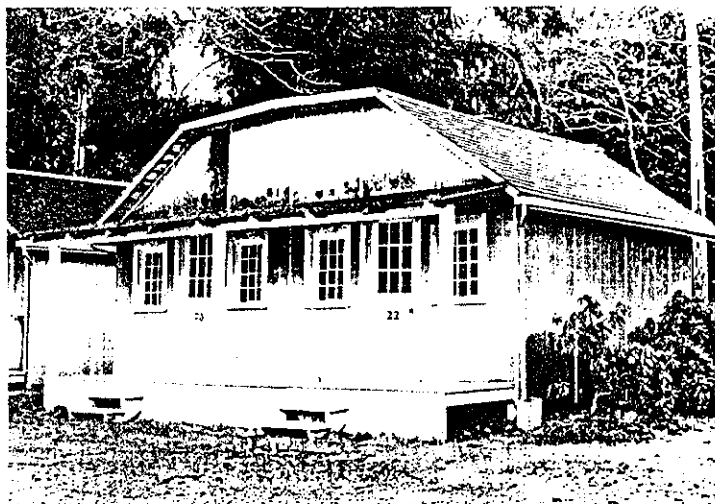

NEG. 37:15

18. LOCATED IN AN HISTORIC DISTRICT?		☐ YES	☒ NO	☐ NAME
19. PUBLIC ACCESSIBILITY		☒ YES, LIMITED	☐ YES, UNLIMITED	
		☐ NO	☐ UNKNOWN	
20. EXISTING SURVEYS		☐ NR	☐ NHL	☐ HABS
		☐ COUNTY	☐ LOCAL	☐ OTHER
21. REFERENCES—HISTORICAL REFERENCES, PERSONAL CONTACTS, AND/OR OTHER		☐ HAER.1	☐ HAER	☒ NPS
				☐ STATE

Florence, Hank, Cathy Gilbert and Gail Evans. 1984. "Historic Structures Report: Lake Crescent Lodge."
National Park Service, Pacific Northwest Region.

22. INVENTORIED BY	AFFILIATION	DATE
Leslie Helm/Gail E. H. Evans	National Park Service	9/82, 1984

PNR-100 6/82

PNRO INVENTORY

National Park Service
Pacific Northwest Region
Cultural Resources Division

Westin Building, Room 1920
2001 Sixth Avenue
Seattle, Washington 98121

1. SITE I.D. NO. 		5. ORIGINAL USE Resort Cabin		7. CLASSIFICATION		8. RATING	
2. NAME(S) OF STRUCTURE 676 CABIN 24 (Singer's Tavern)		6. PRESENT USE Seasonal Resort Cabin				10. DATE c. 1919	
3. SITE ADDRESS (STREET & NO.) Barnes Point; Lake Crescent; Highway 101				9. UTM ZONE EASTING NORTHING 10 440600 5322900		11. REGION PNR	
4. CITY/VICINITY Approx. 20 miles S.W. of Port Angeles, Clallam, Washington		STATE		SCALE 1:24 (1:25) QUAD NAME Lake Crescent			
12. OWNER/ADMIN ADDRESS Department of the Interior, National Park Service, Olympic National Park, 600 East Park Ave., Port Angeles, WA 98362							

13. DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S), PHYSICAL DIMENSIONS, MATERIALS, MAJOR ALTERATIONS, EXISTANT EQUIPMENT, AND IMPORTANT BUILDERS, ARCHITECTS, ENGINEERS, ETC.

Cabin 24 is one of six sleeping cabins standing in a row north of the Singer's Lake Crescent Tavern main lodge and approximately 75 feet from the Lake Crescent shoreline. These cabins stand on the site of an earlier row of wood-frame canvas tent cabins, erected soon after the establishment of Singer's resort. This cabin and its adjacent neighboring cabins were probably constructed around 1919. Unlike the row of six cabins directly east of the main lodge, these cabins have received more extensive alterations since their construction. Possibly in the 1940s the owner joined several cabins by constructing gambrel roofs over adjoining pairs. In the late 1960s, or early 1970s, the existing wood board and batten siding was replaced with simulated board and batten paneling. Porches and interiors have also been replaced or remodeled over the years. In terms of scale, overall design, siting, and landscaping, the entire row of cabins has maintained much of its original integrity. More importantly, Cabin 24 and its adjacent cabins, contribute to the overall feeling and ambience of Singer's Lake Crescent resort. Little is known of the social history of this cabin.

Rectangular in shape; measures 20' x 12' with 4' wide shed roof across main facade; 1 story; wood-frame wall construction pressboard siding; multi-light casement windows; small fixed-light windows on upper portion of door on north elevation. Alterations: none known. Siting: approx. 5 yds. from Lake Crescent shoreline in a row with other



14. CONDITION	☐ EXCELLENT	☐ GOOD	☒ FAIR	☐ DETERIORATED	☐ RUINS	15. DANGER OF DEMOLITION? (SPECIFY THREAT)	☒ YES	☐ NO	☐ UNKNOWN
---------------	------------------------------------	-------------------------------	--	---------------------------------------	--------------------------------	--	---	-----------------------------	----------------------------------

~~XXXXXXXX~~ (Item No. 13 continued)
cabins; part of Singer's Tavern building ensemble.

16. SIGNIFICANCE

This building contributes to the integrity of design, workmanship, setting, and sense of time and place of Singer's Tavern Group.

17. PHOTOS AND SKETCH MAP OF LOCATION

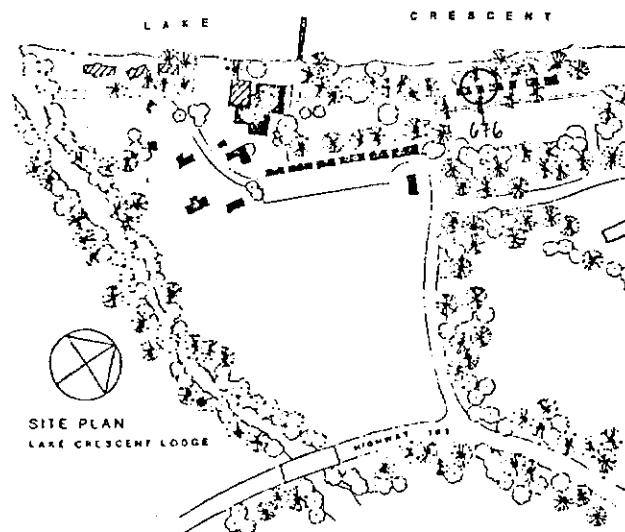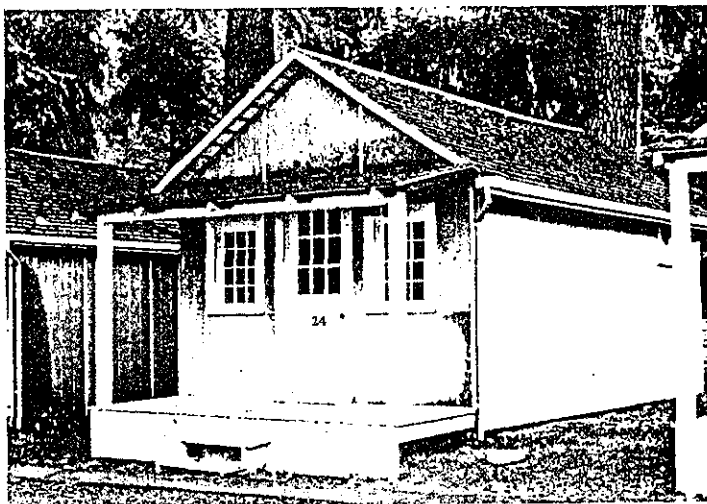

NEG. 37:17

18. LOCATED IN AN HISTORIC DISTRICT?		☐ YES	☒ NO	☐ NAME
19. PUBLIC ACCESSIBILITY		☒ YES, LIMITED	☐ YES, UNLIMITED	
		☐ NO	☐ UNKNOWN	
20. EXISTING SURVEYS		☐ NR	☐ NHL	☐ HABS
		☐ COUNTY	☐ LOCAL	☐ OTHER
21. REFERENCES—HISTORICAL REFERENCES, PERSONAL CONTACTS, AND/OR OTHER		☐ HAER-1	☐ HAER	☒ NPS
		☐ STATE		

Florence, Hank, Cathy Gilbert and Gail Evans. 1984. "Historic Structures Report: Lake Crescent Lodge."
National Park Service, Pacific Northwest Region.

22. INVENTORIED BY	Leslie Helm/Gail E. H. Evans	AFFILIATION	National Park Service	DATE	9/82, 1984
--------------------	------------------------------	-------------	-----------------------	------	------------

PNR-100 6/82

**PNRO
INVENTORY**National Park Service
Pacific Northwest Region
Cultural Resources DivisionWestin Building, Room 1920
2001 Sixth Avenue
Seattle, Washington 98121

1. SITE I.D. NO.		2. NAME(S) OF STRUCTURE 677 CABIN 25 & 26 (Singer's Tavern)		5. ORIGINAL USE Resort Cabins		7. CLASSIFICATION		9. RATING	
3. SITE ADDRESS (STREET & NO.) Barnes Point; Lake Crescent; Highway 101		6. PRESENT USE Seasonal Resort Cabins		8. UTM ZONE 10		EASTING 440600		NORTHING 5322900	
4. CITY/VICINITY Approx. 20 miles S.W. of Port Angeles, Clallam, Washington		COUNTY		STATE		SCALE 1:24 OTHER		QUAD NAME Lake Crescent	
12. OWNER/ADMIN ADDRESS Department of the Interior, National Park Service, Olympic National Park, 600 East Park Ave., Port Angeles, WA 98362									

13. DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S), PHYSICAL DIMENSIONS, MATERIALS, MAJOR ALTERATIONS, EXISTANT EQUIPMENT, AND IMPORTANT BUILDERS, ARCHITECTS, ENGINEERS, ETC.

Cabin 25 and 26 is one of six sleeping cabins standing in a row north of the Singer's Lake Crescent Tavern main lodge and approximately 75 feet from the Lake Crescent shoreline. These cabins stand on the site of an earlier row of wood frame canvas tent cabins, erected soon after the establishment of Singer's resort. This cabin and its adjacent neighboring cabins were probably constructed around 1919. Unlike the row of six cabins directly east of the main lodge, these cabins have received more extensive alterations since their construction. Possibly in the 1940s the owner joined several cabins by constructing gambrel roofs over adjoining pairs. In the late 1960s, or early 1970s, the existing wood board and batten siding was replaced with simulated board and batten paneling. Porches and interiors have also been replaced or remodeled over the years. In terms of scale, overall design, siting, and landscaping, the entire row of cabins has maintained much of its original integrity. More importantly, Cabin 25 and 26 and its adjacent cabins, contribute to the overall feeling and ambience of Singer's Lake Crescent resort. Little is known of the social history of this cabin.

Rectangular in shape; measures 14' x 24' with 4' wide porch; 1 story; wood-frame wall construction; pressboard siding; gambrel roof with wood shingles; shed roof porch across main facade; single leaf, multi-light casement windows frame the two doors on the north elevation. Alterations: shed roof addition which cuts into existing

14. CONDITION	☐ EXCELLENT	☐ GOOD	☒ FAIR	☐ DETERIORATED	☐ RUINS	15. DANGER OF DEMOLITION? (SPECIFY THREAT)	☒ YES	☐ NO	☐ UNKNOWN
---------------	------------------------------------	-------------------------------	--	---------------------------------------	--------------------------------	---	---	-----------------------------	----------------------------------



13. CONTINUED (Item No. 13 continued)

gambrel roof. Siting: approx. 5 yards from Lake Crescent in row arrangement with other cabins; part of the Singer's Tavern building group.

16. SIGNIFICANCE

This building contributes to the integrity of design, workmanship, setting, and sense of time and place of Singer's Tavern group.

17. PHOTOS AND SKETCH MAP OF LOCATION

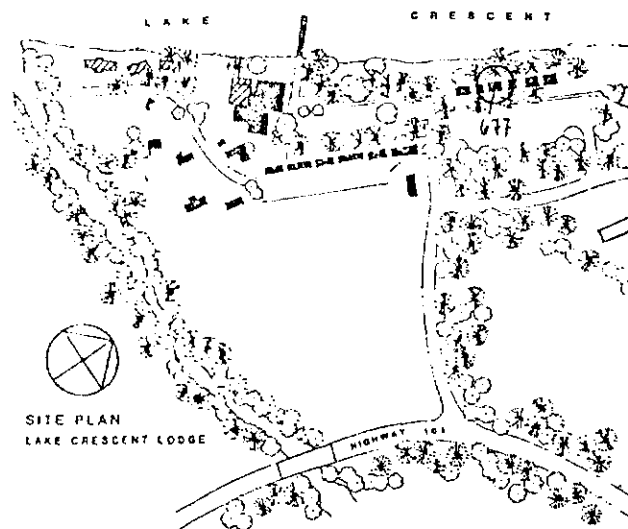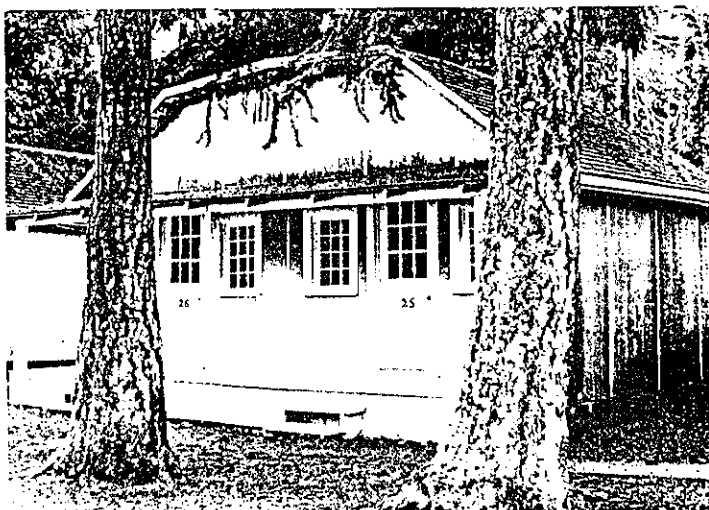

NEG. 37:18

18. LOCATED IN AN HISTORIC DISTRICT?		☐ YES ☒ NO ☐ NAME		20. EXISTING SURVEYS		☐ NR ☐ NHL ☐ HABS ☐ HAER-1 ☐ HAER ☒ NPS ☐ STATE	
19. PUBLIC ACCESSIBILITY		☒ YES, LIMITED ☐ YES, UNLIMITED ☐ NO ☐ UNKNOWN		☐ COUNTY ☐ LOCAL ☐ OTHER			
21. REFERENCES—HISTORICAL REFERENCES, PERSONAL CONTACTS, AND/OR OTHER							

Florence, Hank, Cathy Gilbert and Gail Evans. 1984. "Historic Structures Report: Lake Crescent Lodge."
National Park Service, Pacific Northwest Region.

22. INVENTORIED BY	Leslie Helm/Gail E. H. Evans	AFFILIATION	National Park Service	DATE	9/82, 1984
--------------------	------------------------------	-------------	-----------------------	------	------------

PNR-100 6/82

**PNRO
INVENTORY**National Park Service
Pacific Northwest Region
Cultural Resources DivisionWestin Building, Room 1920
2001 Sixth Avenue
Seattle, Washington 98121

1. SITE I.D. NO. 		2. NAME(S) OF STRUCTURE 678 CABIN 27 (Singer's Tavern)		3. ORIGINAL USE Resort Cabin	4. CLASSIFICATION	5. RATING
3. SITE ADDRESS (STREET & NO.) Barnes Point; Lake Crescent; Highway 101		6. PRESENT USE Seasonal Resort Cabin		7. DATE c. 1919		
4. CITY/VICINITY Approx. 20 miles S.W. of Port Angeles, Clallam, Washington		5. STATE WA		6. UTM ZONE 10		7. EASTING 440600
				8. NORTHING 5322425		9. REGION PNR
10. OWNER/ADMIN ADDRESS Department of the Interior, National Park Service, Olympic National Park, 600 East Park Ave., Port Angeles, WA 98362		11. SCALE 1:24 (1:625)		12. QUAD NAME Lake Crescent		

13. DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S), PHYSICAL DIMENSIONS, MATERIALS, MAJOR ALTERATIONS, EXISTANT EQUIPMENT, AND IMPORTANT BUILDERS, ARCHITECTS, ENGINEERS, ETC.

Cabin 27 is one six sleeping cabins standing in a row north of the Singer's Lake Crescent Tavern main lodge and approximately 75 feet from the Lake Crescent shoreline. These cabins stand on the site of an earlier row of wood frame canvas tent cabins, erected soon after the establishment of Singer's resort. This cabin and its adjacent neighboring cabins were probably constructed around 1919. Unlike the row of six cabins directly east of the main lodge, these cabins have received more extensive alterations since their construction. Possibly in the 1940s the owner joined several cabins by constructing gambrel roofs over adjoining pairs. In the late 1960s, or early 1970s, the existing wood board and batten siding was replaced with simulated board and batten paneling. Porches and interiors have also been replaced or remodeled over the years. In terms of scale, overall design, siting, and landscaping, the entire row of cabins has maintained much of its original integrity. More importantly, Cabin 27 and its adjacent cabins, contributes to the overall feeling and ambience of Singer's Lake Crescent resort. Little is known of the social history of this cabin.

Rectangular in shape; measures 20' x 12' with 4' wide shed roof across main facade; 1 story; wood-frame wall construction with pressboard siding; multi-light casement windows; small fixed-light windows on upper portion of door on north elevation. Alterations: none known. Siting: approx. 5 yards from Lake Crescent shoreline in a row with

14. CONDITION	☐ EXCELLENT	☐ GOOD	☒ FAIR	☐ DETERIORATED	☐ RUINS	15. DANGER OF DEMOLITION? (SPECIFY THREAT)	☒ YES	☐ NO	☐ UNKNOWN
---------------	------------------------------------	-------------------------------	--	---------------------------------------	--------------------------------	--	---	-----------------------------	----------------------------------



~~XXXXXX~~ (Item No. 13 continued)

other cabins; part of Singer's Tavern building ensemble.

16. SIGNIFICANCE

This building contributes to the integrity of design, workmanship, setting, and sense of time and place of Singer's Tavern Group.

17. PHOTOS AND SKETCH MAP OF LOCATION

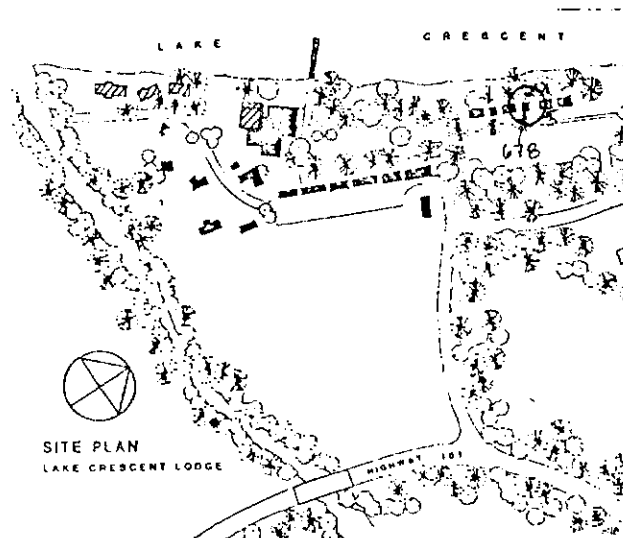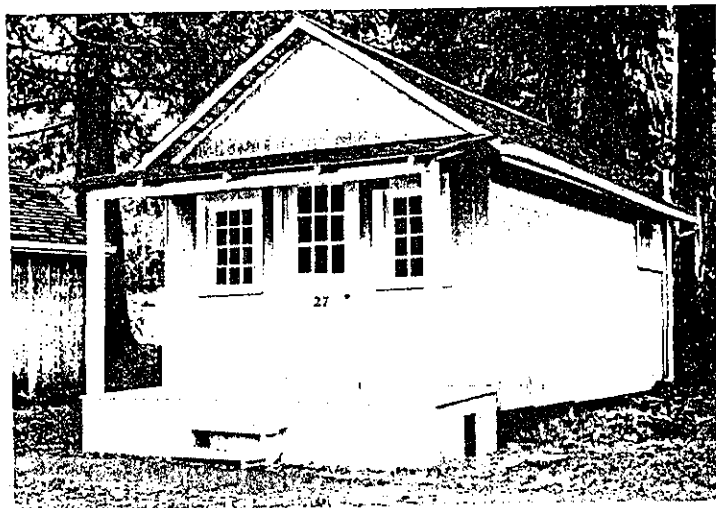

NEG. 37:19

18. LOCATED IN AN HISTORIC DISTRICT?		☐ YES ☒ NO ☐ NAME		20. EXISTING SURVEYS		☐ NR ☐ NHL ☐ HABS ☐ HAER-1 ☐ HAER ☒ NPS ☐ STATE	
19. PUBLIC ACCESSIBILITY		☒ YES, LIMITED ☐ YES, UNLIMITED ☐ UNKNOWN		☐ COUNTY ☐ LOCAL ☐ OTHER			
21. REFERENCES—HISTORICAL REFERENCES, PERSONAL CONTACTS, AND/OR OTHER							

Florence, Hank, Cathy Gilbert and Gail Evans. 1984. "Historic Structures Report: Lake Crescent Lodge."
National Park Service, Pacific Northwest Region.

22. INVENTORIED BY	Leslie Helm/Gail E. H. Evans	AFFILIATION	National Park Service	DATE	9/82, 1984
--------------------	------------------------------	-------------	-----------------------	------	------------

PNR-100 6/82

PNRO INVENTORY

National Park Service
Pacific Northwest Region
Cultural Resources Division

Westin Building, Room 1920
2001 Sixth Avenue
Seattle, Washington 98121

1. SITE I.D. NO. 		5. ORIGINAL USE Resort Cabins		7. CLASSIFICATION		9. RATING	
2. NAME(S) OF STRUCTURE 679 CABIN 28 & 29 (Singer's Tavern)		6. PRESENT USE Seasonal Resort Cabin		10. DATE c. 1919			
3. SITE ADDRESS (STREET & NO.) Barnes Point; Lake Crescent; Highway 101		8. UTM ZONE 10		EASTING 4406005		NORTHING 322925	
4. CITY/VICINITY Approx. 20 miles S.W. of Port Angeles, Clallam, Washington		STATE WA		SCALE 1:24 (1:525)		QUAD NAME Lake Crescent	
12. OWNER/ADMIN ADDRESS Department of the Interior, National Park Service, Olympic National Park, 600 East Park Ave., Port Angeles, WA 98362							
13. DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S), PHYSICAL DIMENSIONS, MATERIALS, MAJOR ALTERATIONS, EXISTANT EQUIPMENT, AND IMPORTANT BUILDERS, ARCHITECTS, ENGINEERS, ETC. Cabin 28 & 29 is one of six sleeping cabins standing in a row north of the Singer's Lake Crescent Tavern main lodge and approximately 75 feet from the Lake Crescent shoreline. These cabins stand on the site of an earlier row of wood-frame canvas tent cabins, erected soon after the establishment of Singer's resort. This cabin and its adjacent neighboring cabins were probably constructed around 1919. Unlike the row of six cabins directly east of the main lodge, these cabins have received more extensive alterations since their construction. Possibly in the 1940s the owner joined several cabins by constructing gambrel roofs over adjoining pairs. In the late 1960s, or early 1970s, the existing wood board and batten siding was replaced with simulated board and batten paneling. Porches and interiors have also been replaced or remodeled over the years. In terms of scale, overall design, siting, and landscaping, the entire row of cabins has maintained much of its original integrity. More importantly, Cabin 28 & 29 and its adjacent cabins, contribute to the overall feeling and ambience of Singer's Lake Crescent resort. Little is known of the social history of this cabin. Rectangular in shape; measures 14' x 24' with 4' wide porch; 1 story; wood-frame wall construction; pressboard siding; gambrel roof with wood shingles; shed roof porch across main facade; single leaf, multi-light casement windows frame the two doors on the north elevation. Alterations: shed roof addition which cuts into existing window							
14. CONDITION ☐ EXCELLENT ☐ GOOD ☒ FAIR ☐ DETERIORATED ☐ RUINS				15. DANGER OF DEMOLITION? (SPECIFY THREAT) ☒ YES ☐ NO ☐ UNKNOWN			



XXXXXXXX (Item No. 13 continued)

on rear south elevation; probable joining of 2 gable roofs under existing gambrel roof. Siting: approx. 5 yards from Lake Crescent in row arrangement with other cabins; part of the Singer's Tavern building group.

16. SIGNIFICANCE

This building contributes to the integrity of design, workmanship, setting, and sense of time and place of Singer's Tavern Group.

17. PHOTOS AND SKETCH MAP OF LOCATION

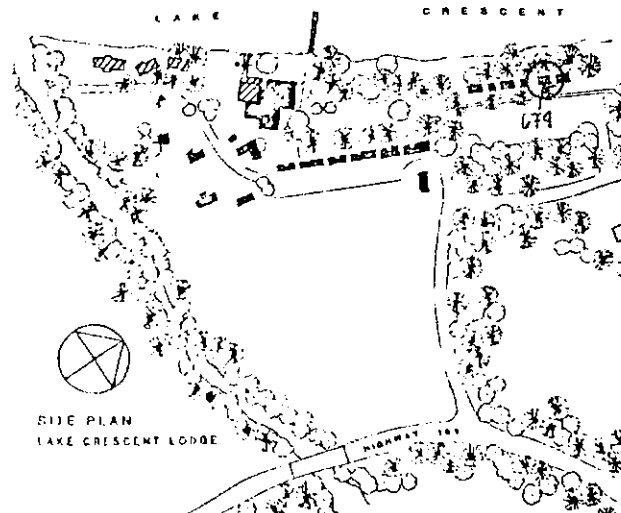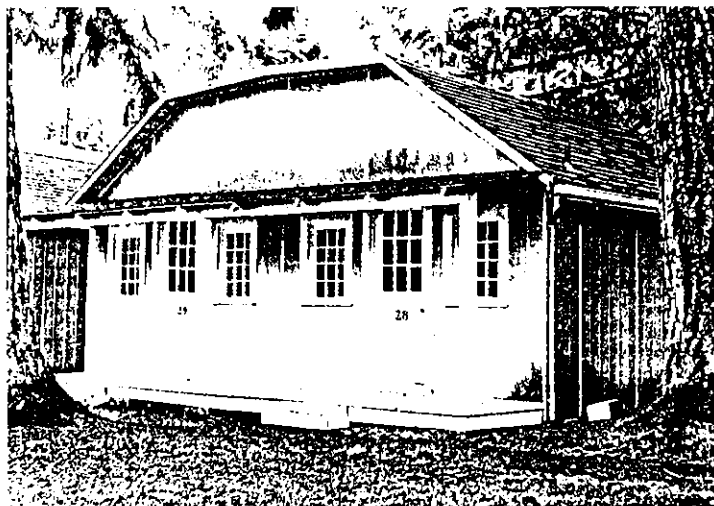

NEG. 37:20

18. LOCATED IN AN HISTORIC DISTRICT? ☐ YES ☒ NO ☐ NAME		20. EXISTING SURVEYS ☐ NPS ☐ NNL ☐ HABS ☐ HAER-1 ☐ HAER ☒ NPS ☐ STATE	
19. PUBLIC ACCESSIBILITY ☒ YES, LIMITED ☐ YES, UNLIMITED ☐ NO ☐ UNKNOWN		☐ COUNTY ☐ LOCAL ☐ OTHER	
21. REFERENCES—HISTORICAL REFERENCES, PERSONAL CONTACTS, AND/OR OTHER			

Florence, Hank, Cathy Gilbert and Gail Evans. 1984. "Historic Structures Report: Lake Crescent Lodge."
National Park Service, Pacific Northwest Region.

22. INVENTORIED BY	Leslie Helm/Gail E. H. Evans	AFFILIATION	National Park Service	DATE	9/82, 1984
--------------------	------------------------------	-------------	-----------------------	------	------------

PNR-100 6/82

**PNRO
INVENTORY**National Park Service
Pacific Northwest Region
Cultural Resources DivisionWestin Building, Room 1920
2001 Sixth Avenue
Seattle, Washington 98121

1. SITE I.D. NO. 		5. ORIGINAL USE Resort Cabins		7. CLASSIFICATION		9. RATING	
2. NAME(S) OF STRUCTURE 680 CABIN 30 & 31 (Singer's Tavern)		6. PRESENT USE Seasonal Resort Cabins				10. DATE c. 1919	
3. SITE ADDRESS (STREET & NO.) Barnes Point; Lake Crescent; Highway 101							
4. CITY/VICINITY Approx. 20 miles S.W. of Port Angeles, Clallam, Washington		STATE Washington		8. UTM ZONE 10		EASTING 4406005	
				NORTHING 322925		11. REGION PNR	
		SCALE 1:24 (1:625)		QUAD NAME Lake Crescent			

12. OWNER/ADMIN ADDRESS
Department of the Interior, National Park Service, Olympic National Park, 600 East Park Ave., Port Angeles, WA 98362

13. DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S), PHYSICAL DIMENSIONS, MATERIALS, MAJOR ALTERATIONS, EXTANT EQUIPMENT, AND IMPORTANT BUILDERS, ARCHITECTS, ENGINEERS, ETC.

Cabin 30 and 31 is one of six sleeping cabins standing in a row north of the Singer's Lake Crescent Tavern main lodge and approximately 75 feet from the Lake Crescent shoreline. These cabins stand on the site of an earlier row of wood frame canvas tent cabins, erected soon after the establishment of Singer's resort. This cabin and its adjacent neighboring cabins were probably constructed around 1919. Unlike the row of six cabins directly east of the main lodge, these cabins have received more extensive alterations since their construction. Possibly in the 1940s the owner joined several cabins by constructing gambrel roofs over adjoining pairs. In the late 1960s or early 1970s the existing wood board and batten siding was replaced with simulated board and batten paneling. Porches and interiors have also been replaced or remodeled over the years. In terms of scale, overall design, siting and landscaping, the entire row of cabins has maintained much of its original integrity. More importantly, Cabin 30 and 31, and its adjacent cabins, contribute to the overall feeling and ambience of Singer's Lake Crescent resort. Little is known of the social history of this cabin.

Rectangular in shape; measures 14' x 24' with 4' wide porch; 1 story; wood-frame wall construction; pressboard siding; gambrel roof with wood shingles; shed roof porch across main facade; single-leaf, multi-light casement windows from the two doors on the north elevation. Alterations: shed roof addition which cuts into existing window on rear

14. CONDITION	☐ EXCELLENT	☐ GOOD	☒ FAIR	☐ DETERIORATED	☐ RUINS	15. DANGER OF DEMOLITION? (SPECIFY THREAT)	☒ YES	☐ NO	☐ UNKNOWN
---------------	------------------------------------	-------------------------------	--	---------------------------------------	--------------------------------	---	---	-----------------------------	----------------------------------



***** (Item No. 13 continued)

south elevation; probable joining of 2 gable roofs under existing gambrel roof. Siting: approx. 5 yards from Lake Crescent in row arrangement with other cabins; part of the Singer's Tavern building group.

16. SIGNIFICANCE

This building contributes to the integrity of design, workmanship, setting, and sense of time and place of Singer's Tavern Group.

17. PHOTOS AND SKETCH MAP OF LOCATION

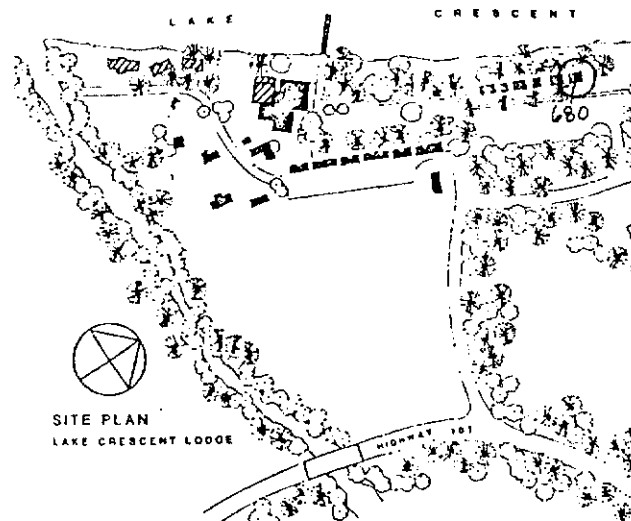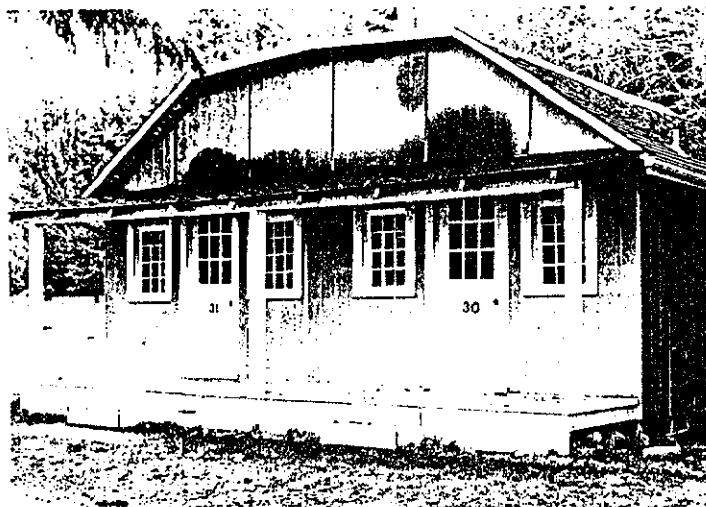

NFG. 37:21

18. LOCATED IN AN HISTORIC DISTRICT? ☐ YES ☒ NO ☐ NAME

19. PUBLIC ACCESSIBILITY ☒ YES, LIMITED ☐ YES, UNLIMITED ☐ NO ☐ UNKNOWN

20. EXISTING SURVEYS ☐ NR ☐ NHL ☐ HABS ☐ HAER-1 ☐ HAER ☒ NPS ☐ STATE ☐ COUNTY ☐ LOCAL ☐ OTHER

21. REFERENCES--HISTORICAL REFERENCES, PERSONAL CONTACTS, AND/OR OTHER

Florence, Henry, Cathy Gilbert and Gail Evans. 1984. "Historic Structures Report: Lake Crescent Lodge." National Park Service, Pacific Northwest Region.

22. INVENTORIED BY	Leslie Helm/ Gail E. H. Evans	AFFILIATION	National Park Service	DATE	9/82, 1984
--------------------	-------------------------------	-------------	-----------------------	------	------------

HISTORIC AMERICAN BUILDINGS SURVEY

INDEX TO PHOTOGRAPHS

HABS
WASH,
5-POAN. V,
1-J-

Singer's Lake Grescent Tavern (Lake Grescent Lodge),
Gabins 22-31 (Bldg. Nos. 675-680)
Barnes Point, Lake Grescent
Olympic National Park
Port Angeles Vicinity
Clallam County
Washington

HABS No. WA-186-J

Marty Stupich, Photographer Summer 1983

NOTE: These photographs are full-frame 4" x 5" enlargements from 2-1/4" x 2-1/4" negatives.

- WA-186-J-1 GENERAL VIEW OF CABIN GROUP, LOOKING NORTH
- WA-186-J-2 LAKE CRESCENT LODGE GABIN 675, WEST ELEVATION, LOOKING EAST
- WA-186-J-3 LAKE CRESCENT LODGE GABIN 675, EAST ELEVATION, LOOKING WEST
- WA-186-J-4 LAKE CRESCENT LODGE CABIN 676, SOUTHWEST FACADE, LOOKING NORTHEAST
- WA-186-J-5 LAKE CRESCENT LODGE GABIN 677, WEST ELEVATION, LOOKING EAST
- WA-186-J-6 LAKE CRESCENT LODGE GABIN 678, WEST ELEVATION, LOOKING EAST
- WA-186-J-7 LAKE CRESCENT LODGE CABIN 679, WEST FACADE, LOOKING SOUTHEAST
- WA-186-J-8 LAKE CRESCENT LODGE CABIN 680, WEST ELEVATION, LOOKING EAST

NOTE: For additional written historical and descriptive data, please see the main entry for Singer's Lake Grescent Tavern (Lake Crescent Lodge), HABS No. WA-186.

OLYM 675-680



HABS NO. WA-186-J-1

OLYM 675 VIEW 1



HABS No. WA-186-J-2

OLYM 675 VIEW 3



HABS NO. WA-186-J-3

OLYM 676 VIEW 1



HABS NO. WA-196-J-4

OLYM 677 VIEW 1



HABS No. WA-186-J-5

OLYM 678
849 WK70



HABS NO. WA-186-J-6

OLYM 679



HABS No. WA-136-J-7

OLYM 680
089



HABS No. WA-186-J-3